



# Home Report

[shepherd.co.uk](http://shepherd.co.uk)



**SHEPHERD**

**CHARTERED SURVEYORS**

All Angles Covered

Residential | Commercial | Property & Construction



## Contents

---

1. Scottish Single Survey
  2. Energy Performance Certificate
  3. Property Questionnaire
-



# Scottish Single Survey



# Single Survey

survey report on:

|                           |   |
|---------------------------|---|
| <b>Property address</b>   | 12a Links Street<br>Musselburgh<br>EH21 6JL |
| <b>Customer</b>           | Executors of the late Edward Catling        |
| <b>Customer address</b>   | 12a Links Street<br>Musselburgh<br>EH21 6JL |
| <b>Prepared by</b>        | Shepherd Chartered Surveyors                |
| <b>Date of inspection</b> | 07/01/2025                                  |



[www.shepherd.co.uk](http://www.shepherd.co.uk)

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report<sup>2</sup>.

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments



being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

# Terms and Conditions

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

|  |   |
|--|---|
| <b>Description</b>                               | Purpose built upper villa.  |
| <b>Accommodation</b>                             | First Floor: Entrance Hall, Living Room, Kitchen, Utility Cupboard, Bedroom and Shower Room with WC.<br><br>Attic Floor: Two Store Rooms.             |
| <b>Gross internal floor area (m<sup>2</sup>)</b> | The gross internal floor area extends to 58 square metres or thereby (excluding attic store rooms).   |
| <b>Neighbourhood and location</b>                | The subjects are situated in the East Lothian town of Musselburgh being convenient for all local amenities.   |
| <b>Age</b>                                       | 1900 approximately.   |
| <b>Weather</b>                                   | Dry and overcast.   |
| <b>Chimney stacks</b>                            | <b>Visually inspected with the aid of binoculars where appropriate.</b><br><br>Chimney stacks are of pointed stone and rendered masonry construction. |

|  |   |
|--|---|
| <b>Roofing including roof space</b>        | <p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is pitched and slated.</p> <p>Access was afforded into the roof eaves via hatches at attic level. "Head and shoulders" inspections were carried only due to the presence of insulation. The rear roof pitch could not be inspected due to the lie of the land.</p> |
| <b>Rainwater fittings</b>                  | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Cast iron gutters and downpipes.</p>  |
| <b>Main walls</b>                          | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are built of traditional solid stone, pointed externally with a rendered gable.</p>   |
| <b>Windows, external doors and joinery</b> | <p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows throughout are of a PVC double glazed style. The front access door is of a timber variety.</p>   |
| <b>External decorations</b>                | <p><b>Visually inspected.</b></p> <p>PVC and painted timber finishes.</p>   |

# Single Survey

|   |   |
|---|---|
| <b>Conservatories / porches</b>           | None.   |
| <b>Communal areas</b>                     | <b>Circulation areas visually inspected.</b><br><br>There is a communal vennel providing access to the rear of the block. The subject property is accessed via an external staircase.   |
| <b>Garages and permanent outbuildings</b> | None.   |
| <b>Outside areas and boundaries</b>       | <b>Visually inspected.</b><br><br>The property benefits from a communal courtyard to the rear of the block bounded by stone walls.  |
| <b>Ceilings</b>                           | <b>Visually inspected from floor level.</b><br><br>Plastered ceilings with plasterboard and polysterene tiled ceilings at attic level. There is a timber lining in the utility cupboard.  |
| <b>Internal walls</b>                     | <b>Visually inspected from floor level.</b><br><br><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b><br><br>Internal walls are plastered on the hard with timber stud and plasterboard walls at attic level.   |
| <b>Floors including sub floors</b>        | <b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b><br><br><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b><br><br><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b><br><br>Flooring throughout is of suspended timber construction. |

# Single Survey

|  |   |
|--|---|
| <b>Internal joinery and kitchen fittings</b> | <p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The kitchen fittings comprise wall and base units with worktop surface areas present. The internal doors, skirtings and facings are of a timber variety. There is a sink in the utility cupboard.</p>  |
| <b>Chimney breasts and fireplaces</b>        | <p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>Former fireplaces appear to have been blocked up.</p>   |
| <b>Internal decorations</b>                  | <p><b>Visually inspected.</b></p> <p>Papered and painted throughout.</p>  |
| <b>Cellars</b>                               | <p>None.</p>  |
| <b>Electricity</b>                           | <p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply. The meter located within the bedroom cupboard.</p> |
| <b>Gas</b>                                   | <p>None.</p>  |
| <b>Water, plumbing, bathroom fittings</b>    | <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply. The plumbing, where seen, is of copper supply pipes and PVC waste pipes.</p> <p>Sanitary fittings comprise a two-piece suite plus shower within the shower room.</p>  |

|                                       |  |
|---------------------------------------|--|
| <b>Heating and hot water</b>          | <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property benefits from a partial electric radiator system. Hot water is provided by an immersion heater with the hot water tank located within the living room cupboard.</p>   |
| <b>Drainage</b>                       | <p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Presumed to be to the main public sewer.</p>   |
| <b>Fire, smoke and burglar alarms</b> | <p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.</p> |

|   |   |
|---|---|
| <p><b>Any additional limits to inspection</b></p> | <p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>The property was fully floor covered at the time of inspection.</p> <p>No access was available beneath sanitary or kitchen fittings.</p> <p>Windows and external doors were not all fully opened or tested.</p> <p>"Head and shoulders" inspection of the roof eaves was carried out only.</p> <p>The external fabric of the building was inspected from ground level only.</p> <p>The rear roof pitch could not be inspected due to the lie of the land.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.</p> |
|---|---|



## Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3   | Category 2  | Category 1                               |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

|  Structural movement |  |
|---|--|
| <b>Repair category</b>  | 1  |
| <b>Notes</b>  | Evidence of settlement/movement has affected the building. On the basis of a single inspection this appears longstanding with no evidence of recent movement apparent. |

|  Dampness, rot and infestation |  |
|--|--|
| <b>Repair category</b>   | 2  |
| <b>Notes</b>   | Moisture meter readings were recorded to wall linings at attic level and further specialist advice should be sought as to all remedial works that may be required. Stained timbers within the roof eaves were found to be damp where tested. We would recommend that further specialist advice be sought in this regard. Please see 'roofing' section.<br><br>Mouse droppings noted at attic level. Further specialist advice should be sought in this regard. |

|  Chimney stacks |  |
|--|--|
| <b>Repair category</b>   | 2  |
| <b>Notes</b>   | Weathered and damaged stonework noted.<br><br>Our inspection of chimneys was limited but they are of an age and style where a degree of regular ongoing maintenance should be anticipated. |



## Roofing including roof space

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 2  |
| <b>Notes</b>           | <p>Loose and cracked slates were visible together with cracked and loose cement work at the skews.</p> <p>The rear roof pitch could not be inspected due to the lie of the land.</p> <p>We would recommend that a roofing contractor undertake an inspection of the subjects prior to purchase.</p> <p>Please see Dampness, Rot and Infestation Section.</p> <p>The roof is of an age and style where a degree of regular ongoing maintenance should be anticipated, in particular after periods of adverse weather.</p> |



## Rainwater fittings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>Corrosion and vegetation noted to the rainwater goods. We would recommend the rainwater goods be monitored under a heavy downpour and any remedial works carried out thereafter.</p> |



## Main walls

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>Weathered and damaged stonework and cracked point work noted. Ongoing maintenance should be anticipated.</p> |



## Windows, external doors and joinery

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 2  |
| <b>Notes</b>           | <p>A number of the windows are in excess of 20 years old and a number of seals appear to have shrunk. Maintenance and repair should be anticipated.</p> <p>A precautionary check of all windows and doors is always recommended prior to purchase.</p> |

# Single Survey



## External decorations

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | Paint finished and decorated external surfaces will require redecoration on a regular basis. |



## Conservatories/porches

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | N/A |
| <b>Notes</b>           |     |



## Communal areas

|                        |                                       |
|------------------------|---------------------------------------|
| <b>Repair category</b> | 1                                     |
| <b>Notes</b>           | No immediate action or repair needed. |



## Garages and permanent outbuildings

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | N/A |
| <b>Notes</b>           |     |



## Outside areas and boundaries


|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | Weathered stonework noted. Boundary walls should be regularly checked and maintained as necessary. |





## Ceilings


|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>Plaster cracks noted. Polystyrene tiles at attic level can be considered a fire risk and should be removed in accordance with fire safety guidelines.</p> <p>It is presumed all timber linings have been treated with a fire retardant finish.</p> |


# Single Survey


|  Internal walls |  |
|--|--|
| Repair category  | 1  |
| Notes  | It is presumed all timber linings have been treated with a fire retardant finish.<br><br>Plaster cracks noted. |

|  Floors including sub-floors |  |
|---|--|
| Repair category   | 1  |
| Notes   | Some areas of uneven flooring noted.<br><br>Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition. |

|  Internal joinery and kitchen fittings |  |
|---|--|
| Repair category   | 1  |
| Notes   | The unit door under the sink in the utility cupboard requires to be reaffixed.<br><br>Low level internal glazing should be checked for safety glass. |

|  Chimney breasts and fireplaces |   |
|--|---|
| Repair category  | 1   |
| Notes  | All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused. |

|  Internal decorations |   |
|--|---|
| Repair category  | 1   |
| Notes  | The property is in reasonable decorative order. |

|  Cellars |     |
|---|-----|
| Repair category   | N/A |
| Notes   |     |



## Electricity

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | <p>The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.</p> <p>It would appear that the fuse board has recently been replaced and any documentation should be made available in this regard.</p> <p>A number of sockets are located in the skirting boards which can be viewed as a fire risk.</p> <p>A precautionary check of the electrical system is always recommended prior to purchase. No tests were carried out by this firm.</p> |



## Gas

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | N/A |
| <b>Notes</b>           |     |



## Water, plumbing and bathroom fittings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 2  |
| <b>Notes</b>           | <p>The water has been drained down and should be reinstated under professional supervision.</p> <p>Sanitary fittings appear serviceable however surround seals, tiling and finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.</p> <p>Due to the age of the property it is possible that lead plumbing exists. Where this is the case, we would recommend that it be removed/replaced with one of equivalent.</p> <p>We presume the sealants around the sanitary fittings are functional and no defects are present to the adjacent areas. A precautionary check of the areas below and adjacent to the sanitary fittings is always recommended prior to purchase as these areas are prone to leakage.</p> |

# Single Survey



## Heating and hot water

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>The hot water tank is dated and future upgrading should be anticipated. It is presumed that the heating system has been regularly serviced and checked by a suitable contractor. Any documentation to be made available in this regard.</p> <p>The panel heater in the shower room is dated and should be checked by a suitable contractor prior to use.</p> <p>A precautionary check is always recommended prior to purchase. No tests were carried out by this firm.</p> |



## Drainage

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | <p>All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.</p> <p>A precautionary check of the drainage system is always recommended prior to purchase. No tests were carried out by this firm.</p> |

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

|                                       |     |
|---------------------------------------|-----|
| Structural movement                   | 1   |
| Dampness, rot and infestation         | 2   |
| Chimney stacks                        | 2   |
| Roofing including roof space          | 2   |
| Rainwater fittings                    | 2   |
| Main walls                            | 2   |
| Windows, external doors and joinery   | 2   |
| External decorations                  | 1   |
| Conservatories/porches                | N/A |
| Communal areas                        | 1   |
| Garages and permanent outbuildings    | N/A |
| Outside areas and boundaries          | 1   |
| Ceilings                              | 2   |
| Internal walls                        | 1   |
| Floors including sub-floors           | 1   |
| Internal joinery and kitchen fittings | 1   |
| Chimney breasts and fireplaces        | 1   |
| Internal decorations                  | 1   |
| Cellars                               | N/A |
| Electricity                           | 1   |
| Gas                                   | N/A |
| Water, plumbing and bathroom fittings | 2   |
| Heating and hot water                 | 2   |
| Drainage                              | 1   |

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.



## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| 1. Which floor(s) is the living accommodation on?                                      | First & Attic |                                     |    |                                     |
|--|---------------|-------------------------------------|----|-------------------------------------|
| 2. Are there three steps or fewer to a main entrance door of the property?             | Yes           | <input type="checkbox"/>            | No | <input checked="" type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property?                          | Yes           | <input type="checkbox"/>            | No | <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm?   | Yes           | <input type="checkbox"/>            | No | <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen?                 | Yes           | <input checked="" type="checkbox"/> | No | <input type="checkbox"/>            |
| 6. Is there a toilet on the same level as a bedroom?                                   | Yes           | <input checked="" type="checkbox"/> | No | <input type="checkbox"/>            |
| 7. Are all rooms on the same level with no internal steps or stairs?                   | Yes           | <input type="checkbox"/>            | No | <input checked="" type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes           | <input checked="" type="checkbox"/> | No | <input type="checkbox"/>            |

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The property has been altered to form the present accommodation and it should be confirmed that Local Authority documentation has been obtained. In our opinion these alterations can reasonably be classed as historic.

Rights of access, land ownership and maintenance liabilities should be confirmed through an inspection of the Title Deeds.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £285,000 (TWO HUNDRED AND EIGHTY FIVE THOUSAND POUNDS).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

### Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £150,000 (ONE HUNDRED AND FIFTY THOUSAND POUNDS).

|                      |   |
|----------------------|---|
| <b>Signed</b>        | <i>Edward Cook</i><br>Electronically signed :- 05/02/2025 12:50 |
| <b>Report author</b> | Edward Cook   |
| <b>Company name</b>  | J & E Shepherd Chartered Surveyors                              |

# Single Survey

|                       |   |
|-----------------------|---|
| <b>Address</b>        | 187 North Street<br>Musselburgh<br>EH21 6AN |
| <b>Date of report</b> | 07/01/2025                                  |

# Mortgage Valuation Report



## Property Address

Address 12a Links Street, Musselburgh, EH21 6JL  
Seller's Name Executors of the late Edward Catling  
Date of Inspection 07/01/2025

## Property Details

Property Type  House  Bungalow  Purpose built maisonette  Converted maisonette  
 Purpose built flat  Converted flat  Tenement flat  Flat over non-residential use  
 Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Other

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space

Available on site?  Yes  No

Permanent outbuildings:

None.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  Other (specify in General Remarks)  
Roof  Tile  Slate  Asphalt  Felt  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks

Drainage  Mains  Private  None  
Electricity  Mains  Private  None  
Central Heating  Yes  Partial  None  
Water  Mains  Private  None  
Gas  Mains  Private  None

Brief description of Central Heating and any non mains services:

Electric radiators in a number of rooms.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Ill-defined boundaries  Agricultural land included with property  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Shared service connections  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

At the time of inspection the property was found to be in an order consistent with one of its age and type of construction with some items of repair and maintenance noted.

Evidence of settlement/movement has affected the building. On the basis of a single inspection this appears longstanding with no evidence of recent movement apparent.

The property has been altered to form the present accommodation and it should be confirmed that Local Authority documentation has been obtained. In our opinion these alterations can reasonably be classed as historic.

Rights of access, land ownership and maintenance liabilities should be confirmed through an inspection of the Title Deeds.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

The property further benefits from a utility cupboard and two store rooms.

Due to the age of the property ongoing maintenance and repair should be anticipated to the external fabric of the building, in particular, roof, main walls, rainwater fittings, chimney stacks and site boundaries.

## Essential Repairs

None.

Estimated cost of essential repairs

Retention recommended?  Yes  No

Retention amount

## Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

## Valuation

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?  Yes  No

# Mortgage Valuation Report

## Declaration

|                             |   |
|-----------------------------|---|
| Signed                      | <i>Edward Cook</i><br>Electronically signed :- 05/02/2025 12:50 |
| Surveyor's name             | Edward Cook   |
| Professional qualifications | MA (Hons), MSc, MRICS   |
| Company name                | J & E Shepherd Chartered Surveyors                              |
| Address                     | 187 North Street, Musselburgh, EH21 6AN                         |
| Telephone                   | 0131 653 3456   |
| Email Address               | musselburgh@shepherd.co.uk                                      |
| Date of Inspection          | 07/01/2025  |



**Energy  
Performance  
Certificate**





# Energy Performance Certificate (EPC)

# Scotland

Dwellings

12A LINKS STREET, FISHERROW, MUSSELBURGH, EH21 6JL


|                                  |                              |                               |                          |
|----------------------------------|------------------------------|-------------------------------|--------------------------|
| <b>Dwelling type:</b>            | Top-floor maisonette         | <b>Reference number:</b>      | 9315-3729-4100-0673-7206 |
| <b>Date of assessment:</b>       | 07 January 2025              | <b>Type of assessment:</b>    | RdSAP, existing dwelling |
| <b>Date of certificate:</b>      | 09 January 2025              | <b>Approved Organisation:</b> | Elmhurst                 |
| <b>Total floor area:</b>         | 84 m <sup>2</sup>            | <b>Main heating and fuel:</b> | Room heaters, electric   |
| <b>Primary Energy Indicator:</b> | 597 kWh/m <sup>2</sup> /year |                               |                          |

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

|  |                |  |
|--|----------------|--|
| <b>Estimated energy costs for your home for 3 years*</b> | <b>£11,811</b> | See your recommendations report for more information |
| <b>Over 3 years you could save*</b>                      | <b>£9,069</b>  |  |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

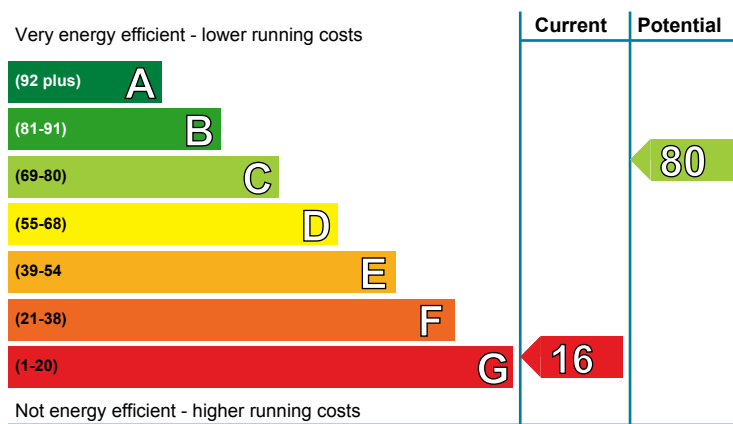


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band G (16)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

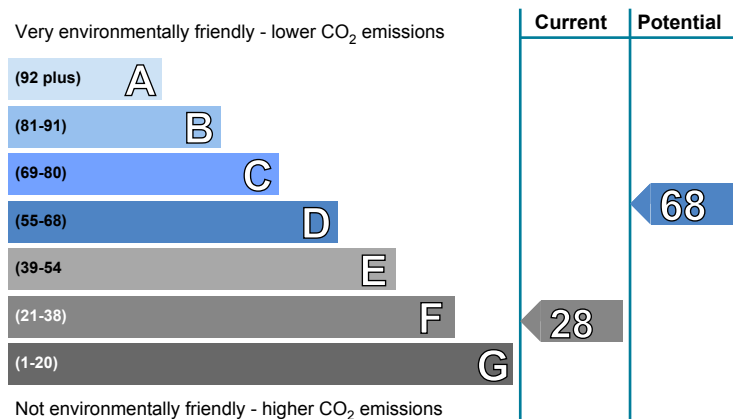

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (28)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

| Recommended measures                   | Indicative cost  | Typical savings over 3 years |
|--|------------------|------------------------------|
| 1 Increase loft insulation to 270 mm   | £100 - £350      | £417.00                      |
| 2 Room-in-roof insulation              | £1,500 - £2,700  | £4170.00                     |
| 3 Internal or external wall insulation | £4,000 - £14,000 | £1470.00                     |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element               | Description   | Energy Efficiency | Environmental  |
|-----------------------|---|-------------------|----------------|
| Walls                 | Sandstone or limestone, as built, no insulation (assumed)               | ★☆☆☆☆             | ★☆☆☆☆          |
| Roof                  | Pitched, 50 mm loft insulation<br>Roof room(s), no insulation (assumed) | ★★☆☆☆<br>★☆☆☆☆    | ★★☆☆☆<br>★☆☆☆☆ |
| Floor                 | (another dwelling below)  | —                 | —              |
| Windows               | Fully double glazed   | ★★★★☆☆            | ★★★★☆☆         |
| Main heating          | Room heaters, electric  | ★☆☆☆☆             | ★★☆☆☆          |
| Main heating controls | Programmer and appliance thermostats                                    | ★★★★☆☆            | ★★★★☆☆         |
| Secondary heating     | Portable electric heaters (assumed)                                     | —                 | —              |
| Hot water             | Electric immersion, standard tariff                                     | ★☆☆☆☆             | ★★☆☆☆          |
| Lighting              | Low energy lighting in 67% of fixed outlets                             | ★★★★☆☆            | ★★★★☆☆         |

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 101 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 5.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















## Estimated energy costs for this home

|               | Current energy costs | Potential energy costs | Potential future savings  |
|---------------|----------------------|------------------------|---|
| Heating       | £8,946 over 3 years  | £1,638 over 3 years    |  |
| Hot water     | £2,499 over 3 years  | £687 over 3 years      |   |
| Lighting      | £366 over 3 years    | £417 over 3 years      |   |
| <b>Totals</b> | <b>£11,811</b>       | <b>£2,742</b>          |   |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures  | Indicative cost  | Typical saving per year | Rating after improvement  |   |
|---|------------------|-------------------------|---|---|
|   |                  |                         | Energy  | Environment   |
| 1 Increase loft insulation to 270 mm                              | £100 - £350      | £139                    |  |  |
| 2 Room-in-roof insulation   | £1,500 - £2,700  | £1390                   |  |  |
| 3 Internal or external wall insulation                            | £4,000 - £14,000 | £490                    |  |  |
| 4 Increase hot water cylinder insulation                          | £15 - £30        | £208                    |  |  |
| 5 High heat retention storage heaters and dual immersion cylinder | £2,000 - £3,000  | £659                    |  |  |
| 6 Heat recovery system for mixer showers                          | £585 - £725      | £47                     |  |  |
| 7 Replacement glazing units                                       | £1,000 - £1,400  | £90                     |  |  |

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

### 3 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 4 Hot water cylinder insulation

Increasing the thickness of existing insulation around the hot water cylinder will help to maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. An additional cylinder jacket or other suitable insulation layer can be used. The insulation should be fitted over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

### 5 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified electrical heating engineer. Ask the engineer to explain the options, which might also include switching to other forms of electric heating.

### 6 Heat recovery system for mixer showers

A shower heat recovery system extracts heat from the water in the shower drain and transfers it to incoming cold water. This reduces the amount of energy needed per shower. Building regulations generally apply to this work, so it is best to check with your local authority building standards department and seek advice from a qualified plumber or heating engineer.

### 7 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 12,333            | (575)                     | N/A                              | (1,486)                         |
| Water heating (kWh per year) | 3,445             |                           |                                  |                                 |

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

|                             |  |
|-----------------------------|--|
| Assessor's name:            | Mr. Edward Cook  |
| Assessor membership number: | EES/013614   |
| Company name/trading name:  | J & E Shepherd   |
| Address:                    | 12 Atholl Crescent<br>Edinburgh<br>EH3 8HA                             |
| Phone number:               | 0131 225 1234  |
| Email address:              | <a href="mailto:edinburgh@shepherd.co.uk">edinburgh@shepherd.co.uk</a> |
| Related party disclosure:   | No related party   |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





# Property Questionnaire





# property questionnaire

|                         |  |
|-------------------------|--|
| <b>Property address</b> | 12 A WINKS STREET<br>MUSSELBORGH<br>EAST LOTHIAN<br>SCOTLAND<br>EH21 6JL |
|-------------------------|--|

|                  |              |
|------------------|--------------|
| <b>Seller(s)</b> | Attmt. + + + |
|------------------|--------------|

|  |              |
|--|--------------|
| <b>Completion date of property questionnaire</b> | 2   2   2025 |
|--|--------------|

# property questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

|           |  |
|-----------|--|
| <b>1.</b> | <b>Length of ownership</b>   |
|           | How long have you owned the property?  |
| <b>2.</b> | <b>Council tax</b>   |
|           | Which Council Tax band is your property in? (Please tick one)<br><input type="checkbox"/> A <input checked="" type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H  |
| <b>3.</b> | <b>Parking</b>   |
|           | What are the arrangements for parking at your property?<br>(Please tick all that apply) <ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input checked="" type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify):</li></ul> |
| <b>4.</b> | <b>Conservation area</b>   |
|           | Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?<br><input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input checked="" type="checkbox"/> Don't know  |

# property questionnaire

|           |   |  |
|-----------|---|--|
| <b>5.</b> | <b>Listed buildings</b>   |  |
|           | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No  |
| <b>6.</b> | <b>Alterations/additions/extensions</b>   |  |
| <b>a.</b> | <p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No                                   |
|           | <p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p> | <input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><br><p style="text-align: right;">N/A</p> |
| <b>b.</b> | <p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No  |
|           | (i) Were the replacements the same shape and type as the ones you replaced?   | <input type="checkbox"/> Yes<br><input type="checkbox"/> No  |
|           | (ii) Did this work involve any changes to the window or door openings?  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No  |
|           | <p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>  |  |

# property questionnaire

|           |   |   |
|-----------|---|---|
| <b>7.</b> | <b>Central heating</b>  |   |
| <b>a.</b> | <p>Is there a central heating system in your property?</p> <p>(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).<br/> <u>If you have answered yes or partial</u> – what kind of central heating is there?</p> <p>(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p> | <input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input checked="" type="checkbox"/> Partial                            |
|           | (i) When was your central heating system or partial central heating system installed?<br>when built   |   |
|           | (ii) Do you have a maintenance contract for the central heating system?<br>If you have answered yes, please give details of the company with which you have a maintenance contract:   | <input type="checkbox"/> Yes<br><input type="checkbox"/> No   |
|           | (iii) When was your maintenance agreement last renewed? (Please provide the month and year).  |   |
| <b>8.</b> | <b>Energy Performance Certificate</b>   |   |
|           | Does your property have an Energy Performance Certificate which is less than 10 years old?  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No   |
| <b>9.</b> | <b>Issues that may have affected your property</b>  |   |
| <b>a.</b> | <p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input type="checkbox"/> Yes<br><input type="checkbox"/> No |
| <b>b.</b> | <p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |

# property questionnaire

| 10. Services   |  |  |
|--|--|--|
| a. Please tick which services are connected to your property and give details of the supplier:           |  |  |
| Services   | Connected  | Supplier   |
| Gas or liquid petroleum gas  | N/A  | —  |
| Water mains or private water supply  | ✓  | East Lothian Council   |
| Electricity  | ✓  | Scottish Gas   |
| Mains drainage   | ✓  | East Lothian Council   |
| Telephone  | ✓  | BT   |
| Cable TV or satellite  | N/A  | —  |
| Broadband  | N/A  | used to have dialup internet with BT but not for years!  |
| b.   | Is there a septic tank system at your property?                                | <input type="checkbox"/> Yes   |
|  | If you have answered yes, please answer the two questions below:               | <input checked="" type="checkbox"/> No   |
|  | (iv) Do you have appropriate consents for the discharge from your septic tank? | <input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input type="checkbox"/> Don't Know |
| (v) Do you have a maintenance contract for your septic tank?   | <input type="checkbox"/> Yes   |  |
| If you have answered yes, please give details of the company with which you have a maintenance contract: | <input type="checkbox"/> No  |  |

# property questionnaire

|            |   |   |
|------------|---|---|
| <b>11.</b> | <b>Responsibilities for shared or common areas</b>  |   |
| <b>a.</b>  | <p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input checked="" type="checkbox"/> Don't Know |
| <b>b.</b>  | <p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p>  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input type="checkbox"/> Not applicable        |
| <b>c.</b>  | <p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No   |
| <b>d.</b>  | <p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input type="checkbox"/> No   |
| <b>e.</b>  | <p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input type="checkbox"/> No   |
| <b>f.</b>  | <p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p> | <input type="checkbox"/> Yes<br><input type="checkbox"/> No   |
| <b>12.</b> | <b>Charges associated with your property</b>  |   |
| <b>a.</b>  | <p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |

# property questionnaire

|                                    |  |  |
|------------------------------------|--|--|
| <p><b>b.</b></p>                   | <p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>   | <p><input type="checkbox"/> Yes<br/> <input checked="" type="checkbox"/> No<br/> <input type="checkbox"/> Don't Know</p> <p><input type="checkbox"/> Yes<br/> <input type="checkbox"/> No<br/> <input type="checkbox"/> Don't Know</p> |
| <p><b>c.</b></p>                   | <p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>  |  |
| <p><b>13. Specialist works</b></p> |  |  |
| <p><b>a.</b></p>                   | <p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>   | <p><input type="checkbox"/> Yes<br/> <input checked="" type="checkbox"/> No</p>  |
| <p><b>b.</b></p>                   | <p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <p><input type="checkbox"/> Yes<br/> <input type="checkbox"/> No</p>   |
| <p><b>c.</b></p>                   | <p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p> | <p><input type="checkbox"/> Yes<br/> <input type="checkbox"/> No</p>   |

# property questionnaire

| 14. Guarantees   |   |                          |                          |                                     |  |                          |
|--|---|--------------------------|--------------------------|-------------------------------------|--|--------------------------|
| <b>a.</b> Are there any guarantees or warranties for any of the following: |   |                          |                          |                                     |  |                          |
|  |   | No                       | Yes                      | Don't know                          | With title deeds   | Lost                     |
| (i)  | Electrical work   | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>   | <input type="checkbox"/> |
| (ii)   | Roofing   | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>   | <input type="checkbox"/> |
| (iii)  | Central heating   | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>   | <input type="checkbox"/> |
| (iv)   | National House Building Council (NHBC)  | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>   | <input type="checkbox"/> |
| (v)  | Damp course   | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>   | <input type="checkbox"/> |
| (vi)   | Any other work or installations?<br>(for example, cavity wall insulation,<br>underpinning, indemnity policy)                                      | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>   | <input type="checkbox"/> |
| <b>b.</b>  | If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):           |                          |                          |                                     |  |                          |
| <b>c.</b>  | Are there any outstanding claims under any of the guarantees listed above?<br><br>If you have answered yes, please give details:                  |                          |                          |                                     | <input type="checkbox"/> Yes<br><input type="checkbox"/> No  |                          |
| 15. Boundaries   |   |                          |                          |                                     |  |                          |
|  | So far as you are aware, has any boundary of your property been moved in the last 10 years?<br><br>If you have answered yes, please give details: |                          |                          |                                     | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input checked="" type="checkbox"/> Don't know |                          |



# property questionnaire

|   |   |  |
|---|---|--|
| <b>16.</b>  | <b>Notices that affect your property</b>  |  |
| In the past three years have you ever received a notice:  |   |  |
| <b>a.</b>   | advising that the owner of a neighbouring property has made a planning application? | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| <b>b.</b>   | that affects your property in some other way?                                       | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| <b>c.</b>   | that requires you to do any maintenance, repairs or improvements to your property?  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property. |   |  |

## Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) : 

\_\_\_\_\_

Date: 02/02/25



- Home Report
- Valuation Report
- Executory Valuation
- Tax Valuations
- Separation Valuation
- Private Sale Valuation
- New Build & Plot Valuation
- Insurance Reinstatement Valuation
- Portfolio Valuation
- Rental Valuation
- Drive By & Desktop Valuation
- Energy Performance Certificate (EPC)
- Level Two Survey & Valuation Report
- Level Two Condition Report
- Expert Witness Report

- Commercial Valuation
- Commercial Agency
- Acquisitions Consultancy
- Commercial Lease Advisory
- Rent Reviews
- Asset Management
- Development Appraisals & Consultancy
- Auctions
- Property Management
- Professional Services
- Licensed Trade & Leisure
- Expert Witness Report
- Rating
- Property Investment
- Public Sector

- Quantity Surveying
- Building Surveying
- Project Management
- Dispute Resolution Support Services
- Principal Designer
- Clerk of Works
- Commercial EPC
- Health & Safety Management
- Employer's Agent
- Energy Consultancy
- Housing Partnerships
- Housing Consultancy
- Development Monitoring
- Mediation Services

**Aberdeen**  
△△△ 01224 202800

**Ayr**  
△△ 01292 267987

**Bearsden**  
△△ 0141 611 1500

**Belfast**  
△ 02890 912975

**Birmingham**  
△ 0121 270 2266

**Coatbridge**  
△△ 01236 436561

**Cumbernauld**  
△△ 01236 780000

**Dalkeith**  
△△ 0131 663 2780

**Dumbarton**  
△△ 01389 731682

**Dumfries**  
△△△ 01387 264333

**Dundee**  
△△ 01382 200454  
△ 01382 220699

**Dunfermline**  
△△ 01383 722337  
△ 01383 731841

**East Kilbride**  
△△ 01355 229317

**Edinburgh**  
△△ 0131 2251234  
△ 0131 557 9300

**Elgin**  
△△ 01343 553939

**Falkirk**  
△△ 01324 635 999

**Fraserburgh**  
△△ 01346 517456

**Galashiels**  
△△ 01896 750150

**Glasgow**  
△△△ 0141 331 2807

**Glasgow South**  
△△ 0141 649 8020

**Glasgow West End**  
△△ 0141 353 2080

**Greenock**  
△△ 01475 730717

**Hamilton**  
△△ 01698 891400

**Inverness**  
△△△ 01463 712239

**Kilmarnock**  
△△ 01563 520318

**Kirkcaldy**  
△△ 01592 205442

**Lanark**  
△△ 01555 663058

**Leeds**  
△ 0113 322 5069

**Livingston**  
△△ 01506 416777

**London**  
△△ 02033 761 236

**Montrose**  
△△ 01674 676768

**Musselburgh**  
△△ 0131 653 3456

**Oban**  
△△ 01631 707 800

**Paisley**  
△△ 0141 889 8334

**Perth**  
△△ 01738 638188  
△ 01738 631631

**Peterhead**  
△△ 01779 470766

**St Andrews**  
△△ 01334 477773  
△ 01334 476469

**Saltcoats**  
△△ 01294 464228

**Stirling**  
△△ 01786 450438  
△ 01786 474476