



**ALLIED**  
**SURVEYORS**  
**SCOTLAND**

# Home Report

---

Marian Grace Dann  
Executry  
120 Candlemakers Park  
Edinburgh  
EH17 8TL

---

Offices throughout Scotland  
[alliedsurveyorsscotland.com](http://alliedsurveyorsscotland.com)

# Single Survey

survey report on:

|                         |   |
|-------------------------|---|
| <b>Property address</b> | 120 Candlemaker's Park,<br>Moredun,<br>EDINBURGH,<br>EH17 8TL |
|-------------------------|---|

|                 |                            |
|-----------------|----------------------------|
| <b>Customer</b> | Marian Grace Dann Executry |
|-----------------|----------------------------|

|                         |  |
|-------------------------|--|
| <b>Customer address</b> | c/o Urquharts WS,<br>16 Heriot Row,<br>Edinburgh,<br>EH3 6HR |
|-------------------------|--|

|                    |                               |
|--------------------|-------------------------------|
| <b>Prepared by</b> | Allied Surveyors Scotland Ltd |
|--------------------|-------------------------------|

|                           |                 |
|---------------------------|-----------------|
| <b>Date of inspection</b> | 13th April 2026 |
|---------------------------|-----------------|



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

# Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

# Terms and Conditions

*the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

|  |  |
|--|--|
| <b>Description</b>                               | Detached bungalow.   |
| <b>Accommodation</b>                             | Entrance and L shaped Hallway, Living/Dining Room with Kitchen area off and large Conservatory off to west: Double Bedroom 1 with fitted wardrobes, Bedroom 2, Shower Room.  |
| <b>Gross internal floor area (m<sup>2</sup>)</b> | House 59m <sup>2</sup> approx.; Conservatory 15m <sup>2</sup> approx.  |
| <b>Neighbourhood and location</b>                | The property forms part of a modern private residential development in the south east suburbs of the city. Local facilities are available within reasonable reach.   |
| <b>Age</b>                                       | The property dates from around 1990.   |
| <b>Weather</b>                                   | It was dry and sunny around the time of visit.   |
| <b>Chimney stacks</b>                            | None.  |
| <b>Roofing including roof space</b>              | <p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is of pitched timber clad in original profiled concrete tiles.</p> <p>There is an access hatch in the landing ceiling leading into the roof</p> |

# Single Survey

|  |   |
|--|---|
| <b>Roofing including roof space</b>        | <p>space. There is approximately 300mm fiberglass insulation quilt between and over the ceiling joists. The gable walls are in blockwork within the roof space. There is a PVC cold water storage tank within the roof space, though the tank is disconnected.</p>  |
| <b>Rainwater fittings</b>                  | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The roof drains to PVC gutters and pipes.</p>   |
| <b>Main walls</b>                          | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are approximately 300mm thick and are of traditional cavity brick/block work, facing brick outer leaf and plasterboard lined internally.</p> <p>Cavity wall insulation has been installed.</p>  |
| <b>Windows, external doors and joinery</b> | <p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are PVC framed double glazed units of slightly mixed style and vintage. All windows appear to be more than 10 years old and, as such, will be beyond any guarantee period.</p> <p>The front entrance door is a PVC frame unit with double glazed panel.</p> <p>There are timber frame double glazed electronically controlled doors between the living/dining room and the conservatory.</p> <p>There are PVC eaves around the roof perimeter.</p> |
| <b>External decorations</b>                | N/A   |
| <b>Conservatories / porches</b>            | <p><b>Visually inspected.</b></p> <p>A large conservatory has been built to the west of the living/dining room. The conservatory has a suspended timber or similar floor, brick/block dado walls, PVC framed double glazed window and door panels and a polycarbonate sheet roof. The conservatory has a radiator from the central heating system and an additional electric heater.</p>  |

# Single Survey


|   |  |
|---|--|
| <b>Communal areas</b>                     | None.  |
| <b>Garages and permanent outbuildings</b> | <p><b>Visually inspected.</b></p> <p>There is a single car size garage on the south side of the property. The garage has a concrete floor, single leaf brick/blockwork walls and a pitched timber roof clad in original concrete tiles. The garage has an up and over vehicular access door and a side pedestrian access door. The garage has electric light and power taken from the house.</p> <p>There is a further dilapidated timber hut in the rear garden.</p>  |
| <b>Outside areas and boundaries</b>       | <p><b>Visually inspected.</b></p> <p>The property has garden ground on all four sides. The grounds are delineated by mixed timber fencing plus there are some open boundaries.</p> <p>There are steel mesh access ramps alongside the north face of the property leading round to the conservatory.</p>  |
| <b>Ceilings</b>                           | <p><b>Visually inspected from floor level.</b></p> <p>Ceilings are of plasterboard.</p>  |
| <b>Internal walls</b>                     | <p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal partitions are of plasterboard lined stud frame.</p>  |
| <b>Floors including sub floors</b>        | <p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>Floors are of suspended timber.</p> <p>The property had firmly fitted floor coverings throughout at the time of visit.</p> <p>No access was gained to any sub floor space.</p> |

|  |  |
|--|--|
| <b>Internal joinery and kitchen fittings</b> | <p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>Internal doors are mixed replacement timber panel style and timber frame glazed panel style. There are fitted wardrobes in the main bedroom.</p> <p>The kitchen fittings comprise modern style floor and wall mounted units including a stainless steel sink and an electric hob.</p>   |
| <b>Chimney breasts and fireplaces</b>        | <p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>There was a free standing electric stove in the living/dining room at the time of visit.</p>   |
| <b>Internal decorations</b>                  | <p><b>Visually inspected.</b></p> <p>The property is decorated in paint, tiling and some panelling.</p>  |
| <b>Cellars</b>                               | <p>None.</p>   |
| <b>Electricity</b>                           | <p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains. The electricity meter is located in a hall cupboard just inside the front entrance door. The installation includes a consumer unit with miniature circuit breakers and a residual current device. Where visible, the installation is in PVC sheathed cabling and serves square pin 13 amp power outlets.</p> |
| <b>Gas</b>                                   | <p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains. The gas meter is located in a box outside on the south elevation.</p> <p>There is a gas fired boiler.</p>  |

|  |  |
|--|--|
| <p><b>Water, plumbing, bathroom fittings</b></p> | <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains. Pipework, where visible, is in copper, alkathene or PVC. There is a PVC cold water storage tank in the roof space, though the tank is now disconnected.</p> <p>The shower room fittings comprise a modern electric shower with floor drain plus there is a white WC and wash hand basin.</p>  |
| <p><b>Heating and hot water</b></p>              | <p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Space heating is provided by a gas fired wet central heating system.</p> <p>In the meter cupboard off the hallway there is an Ideal condensing combination boiler plus there are radiators in the hallway and all main apartments.</p> <p>There is no hot water storage tank. Hot water is heated on demand by the boiler.</p>  |
| <p><b>Drainage</b></p>                           | <p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Foul water and storm water are assumed to be connected to the main public sewer.</p>  |
| <p><b>Fire, smoke and burglar alarms</b></p>     | <p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There are smoke/heat alarms in the hallway, the living/dining room and the kitchen.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire and smoke alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>There is a burglar alarm control panel in the hall meter cupboard.</p> |

|  |  |
|--|--|
| <b>Any additional limits to inspection</b> | <p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>The property had firmly fitted floor coverings throughout at the time of visit.</p> <p>There were a few items in the various storage areas, which restricted access.</p> <p>The building fabric was seen from ground level only.</p> <p>No inspection for asbestos or Japanese knotweed has been carried out.</p> |
|--|--|

## Sectional Diagram showing elements of a typical house

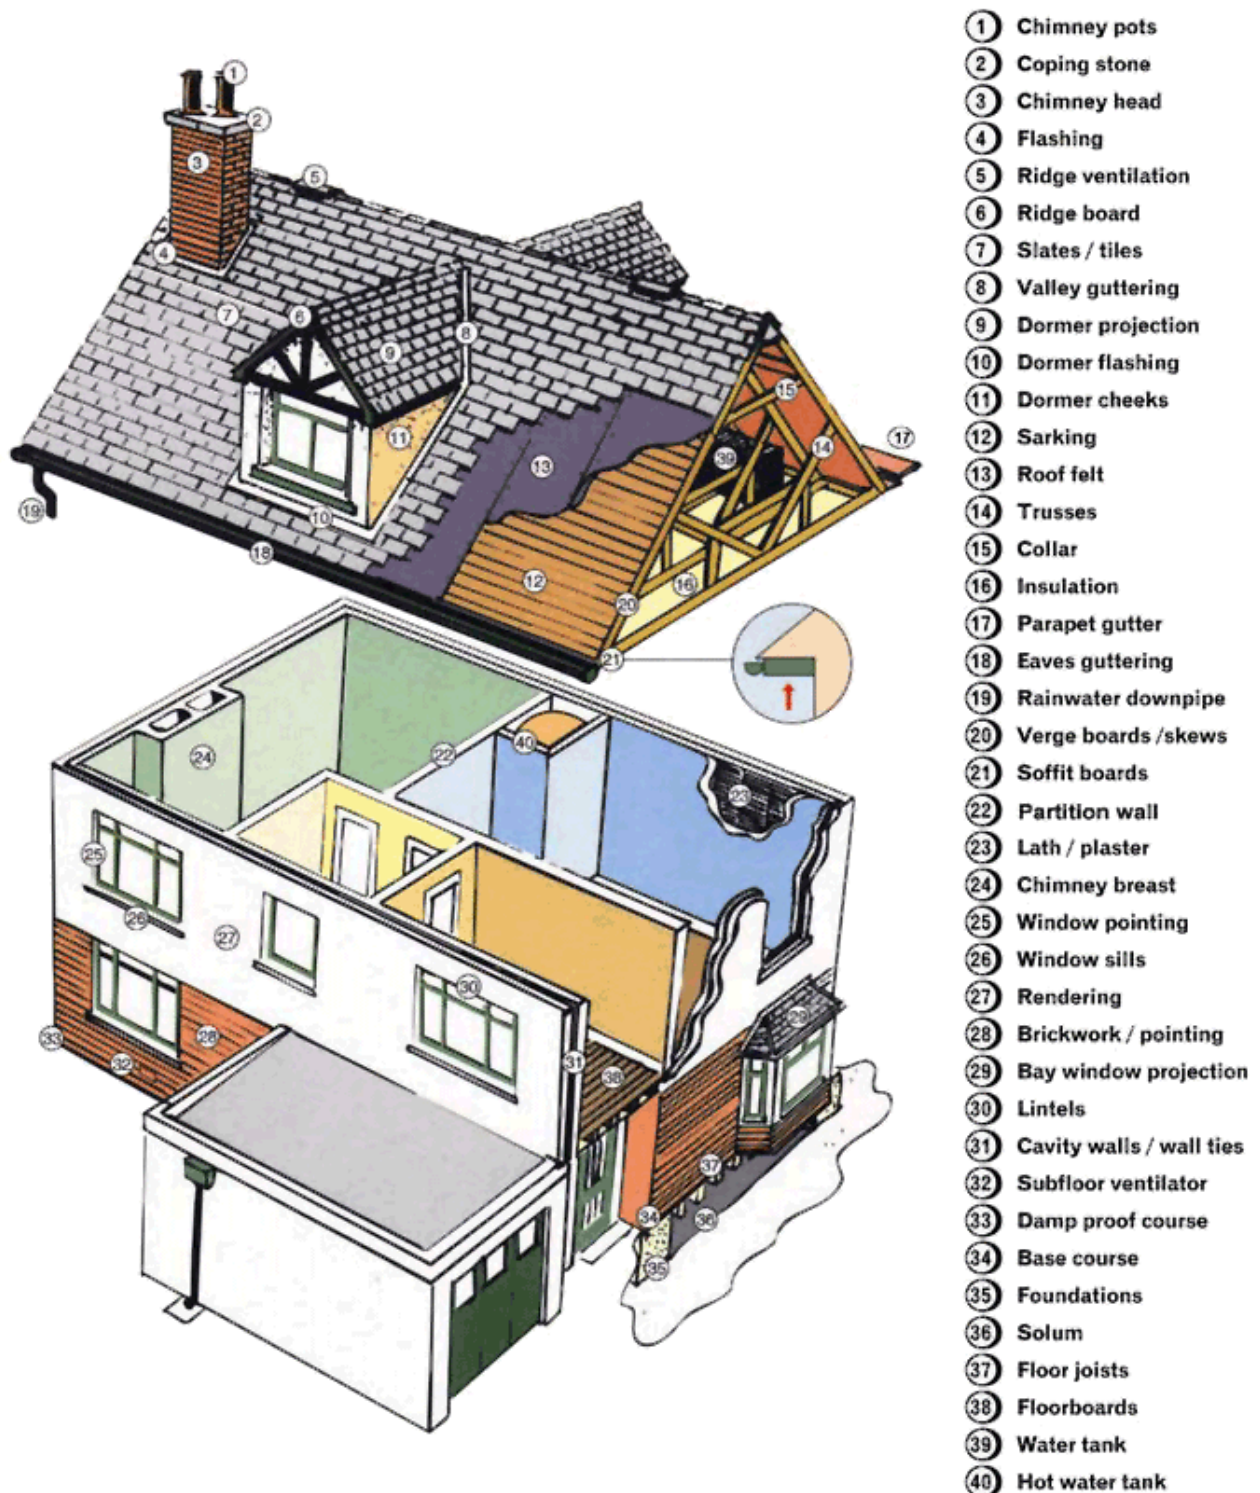


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3   | Category 2  | Category 1                               |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

|  Structural movement |   |
|---|---|
| Repair category   | 1   |
| Notes   | No evidence of any significant or excessive structural movement was identified. |

|  Dampness, rot and infestation |  |
|--|--|
| Repair category  | 1  |
| Notes  | No evidence of such defects was noted in the readily accessible areas of the property. |

|  Chimney stacks |     |
|--|-----|
| Repair category  | -   |
| Notes  | N/A |

|  Roofing including roof space |   |
|--|---|
| Repair category  | 1   |
| Notes  | <p>Some recent repairs have been carried out and replacement tiles fitted on the roof following storm damage. No items of immediate concern were identified. Some moss and debris was noted on the roof. Maintenance should be anticipated.</p> <p>No more than a head and shoulders inspection of the roof space was possible from the access hatch. From what can be seen, no items of immediate concern were identified. There is a good level of insulation, though this would be best evened out. There is a cold water storage tank within the roof space, though the tank has been disconnected.</p> |



## Rainwater fittings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | No items of immediate concern identified.<br><br>The rones and roof drainage should be cleaned out and checked on an annual basis to ensure they function properly. |



## Main walls

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | No items of immediate concern identified. A few pock marks, weathered pointing and the like were noted. Some maintenance should be anticipated. |



## Windows, external doors and joinery

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | No items of immediate concern identified. The windows are of mixed vintage, though are all more than 10 years old and, as such, will be beyond any guarantee period. Some weathering/wear and tear was noted to the windows and maintenance should be anticipated. External doors and other joinery features seem reasonable. Again, maintenance should be anticipated. |



## External decorations

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | -   |
| <b>Notes</b>           | N/A |



## Conservatories/porches

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | No items of immediate concern identified. As with any conservatory, annual maintenance should be anticipated. There is some debris on the conservatory roof. Some weathering/wear and tear was noted to the window and door panels. |



## Communal areas

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | -   |
| <b>Notes</b>           | N/A |



## Garages and permanent outbuildings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No items of immediate concern identified. The garage was part filled with stored items at the time of visit, which restricted access. Some weathering was noted to the garage fabric. Maintenance should be anticipated. |



## Outside areas and boundaries

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | The grounds were reasonably presented at the time of visit. On the north boundary a replacement timber fence has been put up in recent times. Other boundaries are in mixed state. There is ivy growing over the fence on the west boundary. Continuing general maintenance to grounds and boundaries should be anticipated. |



## Ceilings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No items of immediate concern identified. Artex finishes remain on the shower room ceiling. It is assumed these do not contain asbestos. |



## Internal walls

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No items of immediate concern identified. Minor wear and tear was noted. |



## Floors including sub-floors

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | From a general walk over, no items of immediate concern were identified. The property had firmly fitted floor coverings throughout at the time of visit. No access was gained to any sub floor space. |



## Internal joinery and kitchen fittings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | No items of immediate concern identified. There is a cracked mirror panel to one of the fitted wardrobes in bedroom 1. Other internal doors are replacement units. It is assumed these meet required standard. |



## Internal joinery and kitchen fittings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | The kitchen fittings are of modern style. |



## Chimney breasts and fireplaces

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | -   |
| <b>Notes</b>           | N/A |



## Internal decorations

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | The property was generally well presented at the time of visit. |



## Cellars

|                        |     |
|------------------------|-----|
| <b>Repair category</b> | -   |
| <b>Notes</b>           | N/A |



## Electricity

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | <p>The trade bodies governing electrical installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once every five years, by a competent Electrician.</p> <p>The electrical wiring system should therefore be checked, tested and upgraded if necessary by an NIC/EIC Registered electrician. Any recommendations made with regard to the safety of the installation should be undertaken.</p> |



## Gas

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | <p>The trade bodies governing gas installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once per year, by a Gas Safe Registered Contractor.</p> <p>The gas system should therefore be checked and tested by a Gas Safe registered contractor.</p> |



## Water, plumbing and bathroom fittings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 2  |
| <b>Notes</b>           | <p>The plumbing installation is in modern materials.</p> <p>The shower room fittings are of modern style. Some splits to and loose sections of the floor covering to the shower room were noted. Some attention to these would be best.</p> <p>Some loose pipes were noted in the floor of the cupboard off the living/dining room. It is understood these relate to an original hot water tank, which has been removed.</p> |



## Heating and hot water

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | <p>The central heating/hot water system has not been tested.</p> <p>The central heating/hot water system should be tested/checked by Gas Safe Engineer on entry on behalf of the buyer and subject to a service contract thereafter.</p> <p>It has been assumed that the heating installation has been regularly serviced and that recent service history records will be made available. This should be checked by the conveyancer.</p> |



## Drainage

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | <p>The system has not been tested, though no obvious surface problems were noted.</p> |

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

|                                       |   |
|---------------------------------------|---|
| Structural movement                   | 1 |
| Dampness, rot and infestation         | 1 |
| Chimney stacks                        | - |
| Roofing including roof space          | 1 |
| Rainwater fittings                    | 1 |
| Main walls                            | 1 |
| Windows, external doors and joinery   | 1 |
| External decorations                  | - |
| Conservatories/porches                | 1 |
| Communal areas                        | - |
| Garages and permanent outbuildings    | 1 |
| Outside areas and boundaries          | 1 |
| Ceilings                              | 1 |
| Internal walls                        | 1 |
| Floors including sub-floors           | 1 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces        | - |
| Internal decorations                  | 1 |
| Cellars                               | - |
| Electricity                           | 1 |
| Gas                                   | 1 |
| Water, plumbing and bathroom fittings | 2 |
| Heating and hot water                 | 1 |
| Drainage                              | 1 |

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

|   |   |
|---|---|
| <b>1. Which floor(s) is the living accommodation on?</b>                                      | Ground  |
| <b>2. Are there three steps or fewer to a main entrance door of the property?</b>             | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>3. Is there a lift to the main entrance door of the property?</b>                          | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| <b>4. Are all door openings greater than 750mm?</b>   | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| <b>5. Is there a toilet on the same level as the living room and kitchen?</b>                 | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>6. Is there a toilet on the same level as a bedroom?</b>                                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>7. Are all rooms on the same level with no internal steps or stairs?</b>                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| <b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b> | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The conservatory has been added. It is believed this dates from around 2005.

The internal layout has been altered. It is believed this dates from around 2019.

Further enquiries on alterations to the property should be made. The valuation assumes all necessary authorisations are available.

Maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

The property is in an historic mining area. It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

### Estimated reinstatement cost for insurance purposes

The estimated reinstatement cost for insurance purposes is £250,000 (One Hundred & Fifty Thousand Pounds Sterling) exclusive of VAT other than on fees.

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction, on a reinstatement basis, assuming reconstruction of the property in its existing design and materials. Finishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during reconstruction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers are advised. The figure should be reviewed annually and in light of any future alterations or additions.

### Valuation and market comments

The market value of the property described in the report is £285,000 (Two Hundred & Eighty Five Thousand Pounds Sterling).

This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.

|                      |   |
|----------------------|---|
| <b>Signed</b>        | Security Print Code [365330 = 9060 ]<br>Electronically signed |
| <b>Report author</b> | Peter N M Drennan   |
| <b>Company name</b>  | Allied Surveyors Scotland Ltd                                 |
| <b>Address</b>       | 22 Walker Street, Edinburgh, EH3 7HR                          |

# Single Survey

|                       |                 |
|-----------------------|-----------------|
| <b>Date of report</b> | 16th April 2026 |
|-----------------------|-----------------|

# Mortgage Valuation Report



## Property Address

Address 120 Candlemaker's Park, Moredun, EDINBURGH, EH17 8TL  
Seller's Name Marian Grace Dann Executry  
Date of Inspection 13th April 2026

## Property Details

Property Type  House  Bungalow  Chalet  Purpose built maisonette  
 Coach  Studio  Converted maisonette  Purpose built flat  
 Converted flat  Tenement flat  Flat over non-residential use  Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

### Permanent outbuildings:

Detached single car size garage - concrete floor, brick/blockwork walls, pitched concrete tile clad roof.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  
 Solid  Cavity  Steel frame  Concrete block  Other (specify in General Remarks)

Roof  Tile  Slate  Asphalt  Felt  
 Lead  Zinc  Artificial slate  Flat glass fibre  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No  
If Yes, is this recent or progressive?  Yes  No  
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No  
If Yes to any of the above, provide details in General Remarks.

## Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None  
Electricity  Mains  Private  None  
Central Heating  Yes  Partial  None

Water  Mains  Private  None  
Gas  Mains  Private  None

Brief description of Central Heating:

Full gas fired wet central heating system.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Agricultural land included with property  Ill-defined boundaries  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The property is located in a popular established private residential estate in the south west suburbs. Local facilities are available within reasonable reach.

Internally, the property was generally well presented.

Externally, the building fabric, as seen from ground level, seems to be in generally good condition for its age and type. Typical weathering was noted and some allowance should be made for normal continuing repair and maintenance to the building fabric.

The conservatory has been added and alterations have been carried out to form the present internal layout. The valuation assumes all necessary authorisations are available.

The property is in an historic mining area.

Other accommodation - Conservatory 15m2 approx.

## Essential Repairs

None.

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The property forms a suitable security for loan purposes, subject to individual lender requirements.

## Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £   
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?  Yes  No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed Security Print Code [365330 = 9060 ]  
Electronically signed by:-  
Surveyor's name Peter N M Drennan  
Professional qualifications BSc MRICS  
Company name Allied Surveyors Scotland Ltd  
Address 22 Walker Street, Edinburgh, EH3 7HR  
Telephone 0131 226 6518  
Fax 0131 220 6445  
Report date 16th April 2026

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

120 CANDLEMAKER'S PARK, MOREDUN, EDINBURGH, EH17 8TL

**Dwelling type:** Detached bungalow  
**Date of assessment:** 13 April 2026  
**Date of certificate:** 16 April 2026  
**Total floor area:** 59 m<sup>2</sup>  
**Primary Energy Indicator:** 203 kWh/m<sup>2</sup>/year


**Reference number:** 7016-2924-3100-0477-1292  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

|  |               |  |
|--|---------------|--|
| <b>Estimated energy costs for your home for 3 years*</b> | <b>£3,228</b> | See your recommendations report for more information |
| <b>Over 3 years you could save*</b>                      | <b>£339</b>   |  |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

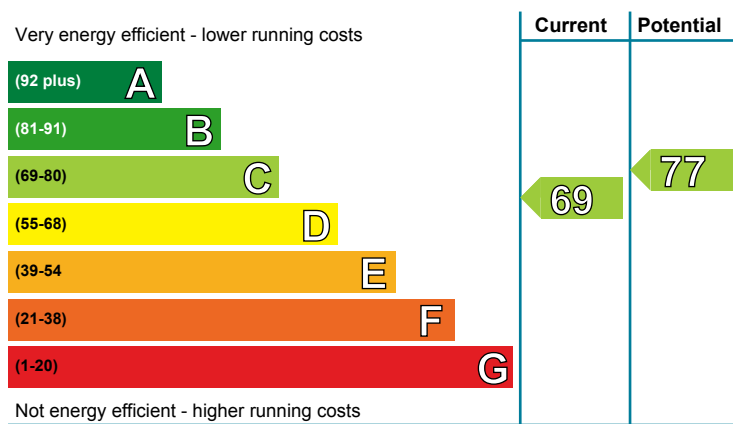


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (69)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

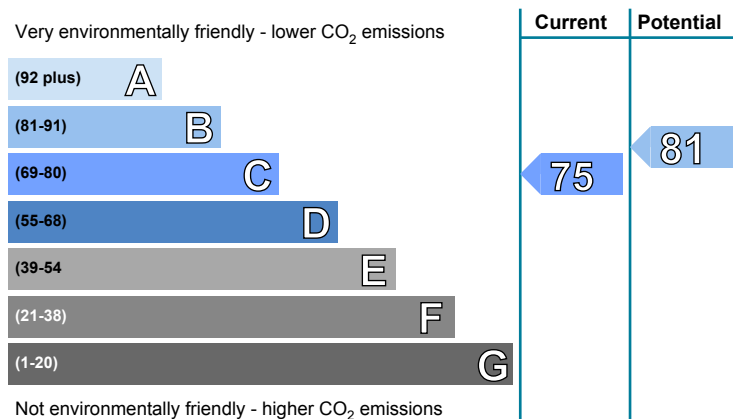

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (75)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

| Recommended measures                 | Indicative cost  | Typical savings over 3 years |
|--------------------------------------|------------------|------------------------------|
| 1 Floor insulation (suspended floor) | £5,000 - £10,000 | £339.00                      |
| 2 Solar photovoltaic (PV) panels     | £8,000 - £10,000 | £612.00                      |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

| Element               | Description                          | Energy Efficiency | Environmental |
|-----------------------|--------------------------------------|-------------------|---------------|
| Walls                 | Cavity wall, filled cavity           | ★★★★☆             | ★★★★☆         |
| Roof                  | Pitched, 300 mm loft insulation      | ★★★★★             | ★★★★★         |
| Floor                 | Suspended, no insulation (assumed)   | —                 | —             |
| Windows               | Fully double glazed                  | ★★☆☆☆             | ★★☆☆☆         |
| Main heating          | Boiler and radiators, mains gas      | ★★★★☆             | ★★★★☆         |
| Main heating controls | Programmer, room thermostat and TRVs | ★★★★☆             | ★★★★☆         |
| Secondary heating     | None                                 | —                 | —             |
| Hot water             | From main system                     | ★★★★☆             | ★★★★☆         |
| Lighting              | Below average lighting efficiency    | ★★★☆☆             | ★★★☆☆         |

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 35 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.




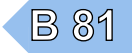
## Estimated energy costs for this home

|               | Current energy costs | Potential energy costs | Potential future savings  |
|---------------|----------------------|------------------------|---|
| Heating       | £2,292 over 3 years  | £1,953 over 3 years    |  |
| Hot water     | £732 over 3 years    | £732 over 3 years      |   |
| Lighting      | £204 over 3 years    | £204 over 3 years      |   |
| <b>Totals</b> | <b>£3,228</b>        | <b>£2,889</b>          |   |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures                 | Indicative cost  | Typical saving per year | Rating after improvement  |   |
|--------------------------------------|------------------|-------------------------|---|---|
|                                      |                  |                         | Energy  | Environment   |
| 1 Floor insulation (suspended floor) | £5,000 - £10,000 | £113                    |  |  |
| 2 Solar photovoltaic panels, 2.5 kWp | £8,000 - £10,000 | £204                    |  |  |

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 7,436.48          | N/A                       | N/A                              | N/A                             |
| Water heating (kWh per year) | 1,384.67          |                           |                                  |                                 |

## Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

|                             |  |
|-----------------------------|--|
| Assessor's name:            | Mr. Peter Drennan  |
| Assessor membership number: | EES/009523   |
| Company name/trading name:  | Allied Surveyors Scotland Ltd  |
| Address:                    | 22 Walker Street<br>Edinburgh<br>EH3 7HR   |
| Phone number:               | 01312266518  |
| Email address:              | <a href="mailto:edinburgh.central@alliedsurveyorsscotland.com">edinburgh.central@alliedsurveyorsscotland.com</a> |
| Related party disclosure:   | Employed by the professional dealing with the property transaction   |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# property questionnaire

|                         |  |
|-------------------------|--|
| <b>Property address</b> | 120 Candlemakers Park<br>Edinburgh<br>EH17 8TL |
|-------------------------|--|

|                  |  |
|------------------|--|
| <b>Seller(s)</b> | Executors of the Late Miss Marian G Dann |
|------------------|--|

|  |           |
|--|-----------|
| <b>Completion date of property questionnaire</b> | 14/4/2026 |
|--|-----------|

# property questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

|           |  |
|-----------|--|
| <b>1.</b> | <b>Length of ownership</b>   |
|           | How long have you owned the property? 10 years   |
| <b>2.</b> | <b>Council tax</b>   |
|           | Which Council Tax band is your property in? (Please tick one)<br><input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input checked="" type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H  |
| <b>3.</b> | <b>Parking</b>   |
|           | What are the arrangements for parking at your property?<br>(Please tick all that apply) <ul style="list-style-type: none"><li>• Garage <input checked="" type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input checked="" type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input checked="" type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify):</li></ul> |
| <b>4.</b> | <b>Conservation area</b>   |
|           | Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?<br><input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input type="checkbox"/> Don't know  |

# property questionnaire

|           |   |  |
|-----------|---|--|
| <b>5.</b> | <b>Listed buildings</b>   |  |
|           | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| <b>6.</b> | <b>Alterations/additions/extensions</b>   |  |
| <b>a.</b> | <p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p> <p>Kitchen and bedroom were reconfigured for improved accessibility.</p>  | <input checked="" type="checkbox"/> Yes<br><input type="checkbox"/> No |
|           | <p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p> | <input checked="" type="checkbox"/> Yes<br><input type="checkbox"/> No |
| <b>b.</b> | <p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
|           | (i) Were the replacements the same shape and type as the ones you replaced?   | <input type="checkbox"/> Yes<br><input type="checkbox"/> No            |
|           | (ii) Did this work involve any changes to the window or door openings?  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No            |
|           | <p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>  |  |

# property questionnaire

|           |  |   |
|-----------|--|---|
| <b>7.</b> | <b>Central heating</b>   |   |
| <b>a.</b> | <p>Is there a central heating system in your property?<br/>           (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).<br/> <u>If you have answered yes or partial</u> – what kind of central heating is there?<br/>           (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).<br/>           Gas-fired<br/> <u>If you have answered yes</u>, please answer the three questions below:</p> | <input checked="" type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input type="checkbox"/> Partial                            |
|           | (i) When was your central heating system or partial central heating system installed?<br>Major upgrade via Warmer Homes Scheme in 2024   |   |
|           | (ii) Do you have a maintenance contract for the central heating system?<br>If you have answered yes, please give details of the company with which you have a maintenance contract:  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |
|           | (iii) When was your maintenance agreement last renewed? (Please provide the month and year).   |   |
| <b>8.</b> | <b>Energy Performance Certificate</b>  |   |
|           | Does your property have an Energy Performance Certificate which is less than 10 years old?   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |
| <b>9.</b> | <b>Issues that may have affected your property</b>   |   |
| <b>a.</b> | <p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?<br/> <u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input type="checkbox"/> Yes<br><input type="checkbox"/> No |
| <b>b.</b> | <p>Are you aware of the existence of asbestos in your property?<br/> <u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |

# property questionnaire

|   |  |                  |  |
|---|--|------------------|--|
| <b>10.</b>  | <b>Services</b>  |                  |  |
| <b>a.</b> Please tick which services are connected to your property and give details of the supplier: |  |                  |  |
|   | <b>Services</b>  | <b>Connected</b> | <b>Supplier</b>  |
|   | Gas or liquid petroleum gas  | <b>Yes</b>       | <b>Scottish Power</b>  |
|   | Water mains or private water supply  | <b>Yes</b>       | <b>Scottish Water</b>  |
|   | Electricity  | <b>Yes</b>       | <b>Scottish Power</b>  |
|   | Mains drainage   | <b>Yes</b>       | <b>Scottish Water</b>  |
|   | Telephone  | <b>Yes</b>       | <b>was Plusnet</b>   |
|   | Cable TV or satellite  | <b>No</b>        |  |
|   | Broadband  | <b>Yes</b>       | <b>was Plusnet</b>   |
| <b>b.</b>   | Is there a septic tank system at your property?<br><u>If you have answered yes</u> , please answer the two questions below:  |                  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No                             |
|   | (iv) Do you have appropriate consents for the discharge from your septic tank?   |                  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No<br><input type="checkbox"/> Don't Know |
|   | (v) Do you have a maintenance contract for your septic tank?<br><u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract: |                  | <input type="checkbox"/> Yes<br><input type="checkbox"/> No  |

# property questionnaire

|            |   |   |
|------------|---|---|
| <b>11.</b> | <b>Responsibilities for shared or common areas</b>  |   |
| <b>a.</b>  | <p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input type="checkbox"/> Don't Know     |
| <b>b.</b>  | <p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input type="checkbox"/> Not applicable |
| <b>c.</b>  | <p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |
| <b>d.</b>  | <p>Do you have the right to walk over any of your neighbours' property – for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |
| <b>e.</b>  | <p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |
| <b>f.</b>  | <p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p> | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |
| <b>12.</b> | <b>Charges associated with your property</b>  |   |
| <b>a.</b>  | <p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |

# property questionnaire

|                                    |  |  |
|------------------------------------|--|--|
| <p><b>b.</b></p>                   | <p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>   | <p><input type="checkbox"/> Yes<br/> <input checked="" type="checkbox"/> No<br/> <input type="checkbox"/> Don't Know</p> <p><input type="checkbox"/> Yes<br/> <input type="checkbox"/> No<br/> <input type="checkbox"/> Don't Know</p> |
| <p><b>c.</b></p>                   | <p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <p>Resident's Association for upkeep of Common Grounds - £75 per year</p>  |  |
| <p><b>13. Specialist works</b></p> |  |  |
| <p><b>a.</b></p>                   | <p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>   | <p><input type="checkbox"/> Yes<br/> <input checked="" type="checkbox"/> No</p>  |
| <p><b>b.</b></p>                   | <p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <p><input type="checkbox"/> Yes<br/> <input checked="" type="checkbox"/> No</p>  |
| <p><b>c.</b></p>                   | <p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p> | <p><input type="checkbox"/> Yes<br/> <input type="checkbox"/> No</p>   |

# property questionnaire

| 14. Guarantees  |   |                                     |                          |                                     |   |                          |
|---|---|-------------------------------------|--------------------------|-------------------------------------|---|--------------------------|
| <b>a.</b> Are there any guarantees or warranties for any of the following:  |   |                                     |                          |                                     |   |                          |
|   |   | No                                  | Yes                      | Don't know                          | With title deeds  | Lost                     |
| (i)   | Electrical work   | <input type="checkbox"/>            | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (ii)  | Roofing   | <input type="checkbox"/>            | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (iii)   | Central heating   | <input type="checkbox"/>            | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (iv)  | National House Building Council (NHBC)  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>            | <input type="checkbox"/>  | <input type="checkbox"/> |
| (v)   | Damp course   | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>            | <input type="checkbox"/>  | <input type="checkbox"/> |
| (vi)  | Any other work or installations?<br>(for example, cavity wall insulation, underpinning, indemnity policy) | <input type="checkbox"/>            | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| <b>b.</b> <u>If you have answered 'yes' or 'with title deeds'</u> , please give details of the work or installations to which the guarantee(s) relate(s): |   |                                     |                          |                                     |   |                          |
| <b>c.</b> Are there any outstanding claims under any of the guarantees listed above?<br><u>If you have answered yes</u> , please give details:            |   |                                     |                          |                                     | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No  |                          |
| 15. Boundaries  |   |                                     |                          |                                     |   |                          |
| So far as you are aware, has any boundary of your property been moved in the last 10 years?<br><u>If you have answered yes</u> , please give details:     |   |                                     |                          |                                     | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No<br><input type="checkbox"/> Don't know |                          |

# property questionnaire

|   |   |  |
|---|---|--|
| <b>16.</b>  | <b>Notices that affect your property</b>  |  |
| In the past three years have you ever received a notice:  |   |  |
| <b>a.</b>   | advising that the owner of a neighbouring property has made a planning application? | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| <b>b.</b>   | that affects your property in some other way?                                       | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| <b>c.</b>   | that requires you to do any maintenance, repairs or improvements to your property?  | <input type="checkbox"/> Yes<br><input checked="" type="checkbox"/> No |
| <u>If you have answered yes to any of a-c above</u> , please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property. |   |  |

## Declaration by the seller(s)/or other authorised body or person(s)

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

Signature(s) :

John M Hannah

Date:

14/4/2026

