



HOME REPORT

Cherry Tree House Eassie Forfar DD8 1ST 26/08/2016

www.millerhendry.co.uk

eport Inde Home

Single Survey Energy Report Property Questionnaire

survey report on:

| Property address | CHERRYTREE COTTAGE EASSIE FORFAR DD8 1ST |
|------------------|---|
|------------------|---|

| Customer | Paul Phillipson-Masters |
|----------|-------------------------|
|----------|-------------------------|

| Customer address | | |
|------------------|--|--|
| | | |
| | | |
| | | |

| Prepared by DM Ha | I |
|-------------------|---|
|-------------------|---|

| Date of inspection | 8th August 2016 |
|--------------------|-----------------|
|--------------------|-----------------|



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1. <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3. <u>Category 1:</u> No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

| Description | Single storey and attic mid terraced cottage. |
|---------------|---|
| Accommodation | Ground floor: Entrance Vestibule, Lounge (with stair to upper floor), Inner Hall, Kitchen/Dining Room, Shower Room (with WC) |
| | Upper floor: Sitting Room, Three Bedrooms, Bathroom (with WC) |

| Gross internal floor area (m²) | Approximately 146 sq. m. |
|--------------------------------|--|
| Neighbourhood and location | The subjects are situated within the hamlet of Eassie which lies approximately 10 miles to the southwest of Forfar on the south side of the A94 Forfar/Coupar Angus road. Surrounding residential properties are of mixed age, size and character. Basic amenities can be found within the surrounding area while others are readily available in Forfar and Dundee, both of which are within easy commuting distance. |

| Age | Understood to have been erected in the mid 19th Century. |
|-----|--|
|-----|--|

| Weather | Dry and sunny. |
|---------|----------------|
|---------|----------------|

| Chimney stacks | Visually inspected with the aid of binoculars where appropriate. |
|----------------|--|
| | Stone built with a pointed finish and metal flashings. |

| Roofing including roof space | Sloping roofs were visually inspected with the aid of binoculars where appropriate. |
|------------------------------|--|
| | Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. |
| | Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as |

| being from a 3m ladder within the property. |
|--|
| If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. |
| The roofs are of pitched timber design and are overlaid in slates, incorporating metal flat roofed dormer projections. |
| I was able to gain access to the roof space by means of a hatch within the upper floor sitting room. The roof is of timber frame construction and glasswool insulation material has been laid throughout. |

| Rainwater fittings | Visually inspected with the aid of binoculars where appropriate. | |
|--------------------|--|--|
| | Gutters and downpipes are formed in cast iron. | |
| | | |
| Main walls | Visually inspected with the aid of binoculars where appropriate. | |

| Foundations and concealed parts were not exposed or inspected. |
|--|
| Solid stone, externally pointed. |

| Windows, external doors and joinery | Internal and external doors were opened and closed where keys were available. |
|-------------------------------------|--|
| | Random windows were opened and closed where possible. |
| | Doors and windows were not forced open. |
| | The subjects are double glazed throughout, being fitted with timber framed units and also "Velux" rooflights. |
| | Access to the property is by means of a timber and double glazed door to the entrance porch, a timber and double glazed door to the inner hall and a double glazed patio door to the lounge. |

| External decorations | Visually inspected. | |
|--------------------------|---|--|
| | External timbers have a painted finish. | |
| | | |
| Conservatories / porches | None. | |
| | | |
| Communal areas | Circulation areas visually inspected. | |
| | There is a mutual footpath to the rear. | |

| Garages and permanent outbuildings | Visually inspected. |
|------------------------------------|---|
| | There is no garage nor space, however off street parking is available within the courtyard to the front. There are no significant outbuildings. |
| | |
| | |
| Outside areas and boundaries | Visually inspected. |
| Outside areas and boundaries | Visually inspected. There are private areas of garden ground lying to the front and rear of the property. |

| The garden area to the rear is laid to lawn with surrounding shrub/flower beds and is bounded by timber fencing. |
|--|

| Ceilings | Visually inspected from floor level. |
|----------|--|
| | Drylined in plasterboard sheets with timber beamed features. |

| Internal walls | Visually inspected from floor level. |
|----------------|---|
| | Using a moisture meter, walls were randomly tested for dampness where considered appropriate. |
| | Drylined in plasterboard sheets. |

| Floors including sub floors | Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. |
|-----------------------------|---|
| | Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. |
| | Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. |
| | Solid concrete and also suspended timber. |
| | Due to various fitted and fixed floor coverings and household furnishings, it was not possible to locate any hatches to the sub-floor areas and, accordingly, no inspection of these areas was possible. |

| Internal joinery and kitchen fittings | Built-in cupboards were looked into but no stored items were moved. |
|---------------------------------------|--|
| | Kitchen units were visually inspected excluding appliances. |
| | The kitchen comprises a series of fully fitted wall mounted and floor standing units. These are of modern contemporary design and incorporate a number of integrated appliances. |
| | Internal doors are of panelled timber. |

| Chimney breasts and fireplaces | Visually inspected. |
|--------------------------------|--|
| | No testing of the flues or fittings was carried out. |
| | There is a timber fire surround within the lounge which houses a solid fuel stove. |
| | |
| Internal decorations | Visually inspected |

| | Internal decorations Visually inspected Mainly emulsion or the sanitary apartm | n plasterboard with tiling and wet wall finishes in |
|--|--|---|
|--|--|---|

| Cellars | None. |
|-------------|---|
| Electricity | Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. The circuit breaker consumer units and electric meters are located within the cupboard in the hall. Visible wiring is of PVC coated cabling with 13 amp sockets throughout. |

| Gas | No supply. |
|-----|------------|
| | |


| Water, plumbing, bathroom fittings | Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. |
|------------------------------------|--|
| | No tests whatsoever were carried out to the system or appliances. |
| | Mains supply. All visible pipework is formed in copper and PVC materials. |
| | The sanitary fitments are of modern contemporary design. |

| Heating and hot water | Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. |
|-----------------------|--|
| | No tests whatsoever were carried out to the system or appliances. |
| | Space heating is provided by means of an oil fired central heating system with radiators throughout the main apartments. The system is fired by means of the Worcester Heatslave boiler which is located within the ground floor shower room. In addition to servicing the radiators, this also provides domestic hot water. |
| | The oil storage tank is located within the garden ground to the front of the property. |

| Drainage | Drainage covers etc. were not lifted. | |
|----------|--|--|
| | Neither drains nor drainage systems were tested. | |
| | Drainage is understood to be to a communal shared reed bed, situated outwith the property. I am advised that this is maintained by Scottish Water. | |

| Fire, smoke and burglar alarms | Visually inspected. |
|--------------------------------|---|
| | No tests whatsoever were carried out to the system or appliances. |
| | Smoke alarms are installed. |

| Any additional limits to inspection | For flats / maisonettes |
|-------------------------------------|---|
| | Only the subject flat and internal communal areas giving access to the flat were inspected. |
| | If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. |
| | The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. |
| | The property was occupied, fully furnished and a variety of fitted and fixed floor coverings, including ceramic tiles were in place. My visual inspection of the roof timbers was restricted to a "head and shoulders" inspection from the vicinity of the access hatch and was further restricted by insulation materials. |
| | In accordance with Health and Safety Guidelines, insulation materials have not been disturbed. Furniture, personal effects (particularly in cupboards) and floor coverings have not been moved. |
| | The metal flat roofs over the dormer projections could not be viewed from ground level. |
| | I have not carried out an inspection for Japanese Knotweed and unless otherwise stated for the purposes of this report I have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. |

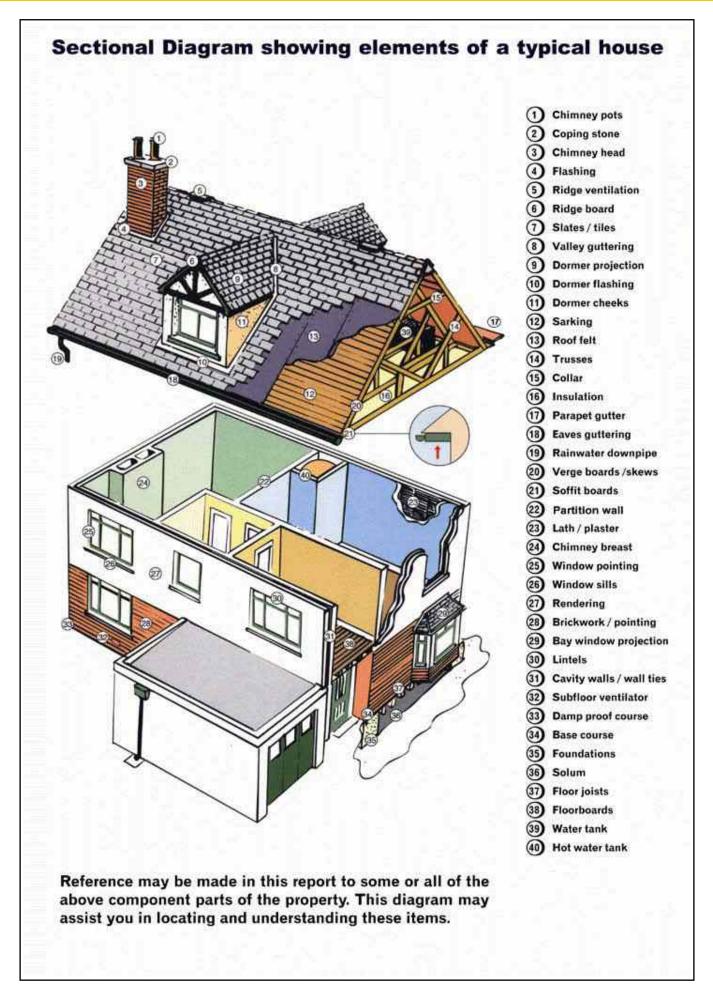

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3 | Category 2 | Category 1 |
|------------|---|------------|
| | Repairs or replacement requiring future attention, but estimates are still advised. | |

| Structural movement | |
|---------------------|---|
| Repair category | 1 |
| Notes | Slight evidence of previous movement was noted within the property as indicated by typical distortion to the building fabric. This is common in properties of this age and type. I found no evidence to suggest that the movement appeared serious and there are no signs of recent movement having occurred. |

| Dampness, rot and infestation | |
|-------------------------------|--|
| Repair category | 1 |
| Notes | Random readings taken using an electronic Protimeter were found to be within acceptable levels with no apparent evidence of rising damp within the main walls. There is, however, evidence of an old and apparently inactive infestation by woodboring insects within roof timbers and exposed beams. It is assumed that previous Timber Specialist remedial treatments in connection with this infestation have been undertaken. |
| | A degree of condensation was noted within the bathroom. This is a lifestyle problem and can be alleviated through improved heating/ventilation. |

| Chimney stacks | |
|-----------------|--|
| Repair category | 1 |
| Notes | Typical weathering of the stonework and cement pointing was noted. |

| Roofing including roof space | |
|---|--|
| 1 | |
| From ground level, a number of loose, chipped and broken slates were evident. This is not uncommon in properties of this age. Refixing/renewal of roof slates will satisfy immediate repair work. | |
| | |

| The flat metal roofs over the dormer projections could not be viewed from ground level. It should be appreciated that these are covered in a material which has a limited life and which requires ongoing repair, maintenance and potentially replacement. Although, at the time of inspection, no evidence of rain penetration was apparent, repair expenditure in this connection should be anticipated. |
|--|
| The cement verge to the front projection is weathering. |
| As detailed earlier, there is evidence of an old and apparently inactive infestation by woodboring insects within the roof timbers. |

| Rainwater fittings | |
|--------------------|--|
| Repair category | 1 |
| Notes | The system appeared watertight with no apparent evidence of leakage or staining to the external faces of the building. |

| Main walls | |
|-----------------|---|
| Repair category | 1 |
| Notes | No immediate action or repair is needed. |
| | The walls appear to have been repointed in the recent past. |

| Windows, external doors and joinery | |
|-------------------------------------|---|
| Repair category | 1 |
| Notes | No immediate action or repair is needed. |
| | It should be appreciated that replacement double glazed units can, however, be problematic and, over time, the operations can be affected and the opening mechanisms damaged. Future maintenance should be anticipated. |

| External decorations | |
|----------------------|--|
| Repair category | 1 |
| Notes | No immediate action or repair is needed. |

| Conservatories/porches | |
|------------------------|-------|
| Repair category | - |
| Notes | None. |

| Communal areas | |
|-----------------|---|
| Repair category | 1 |
| Notes | The mutual footpath appears to have been adequately maintained. |

| Garages and permanent outbuildings | |
|------------------------------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |

| Outside areas and boundaries | |
|------------------------------|--|
| Repair category | 1 |
| Notes | These areas appear to have been adequately maintained. |

| Ceilings | |
|-----------------|--|
| Repair category | 1 |
| Notes | Shrinkage/thermal cracking and surface damage was noted. |

| Internal walls | |
|-----------------|--|
| Repair category | 1 |
| Notes | Shrinkage/thermal cracking and surface damage was noted. |

| Floors including sub-floors | |
|-----------------------------|--|
| Repair category | 1 |
| Notes | Sections of loose/uneven flooring were noted along with loose stair treads/risers. |

| Internal joinery and kitchen fittings | | |
|---------------------------------------|--|--|
| Repair category 1 | | |
| Notes | No immediate action or repair is needed. | |

| Chimney breasts and fireplaces | | |
|--------------------------------|--|--|
| Repair category | 1 | |
| Notes | No immediate action or repair is needed. | |

| Internal decorations | |
|----------------------|--|
| Repair category | 1 |
| Notes | It would not be unreasonable to assume that a prospective purchaser would undertake a programme of redecoration in accordance with personal taste and requirement. |

| Cellars | |
|-----------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |

| Electricity | |
|-----------------|--|
| Repair category | 1 |
| Notes | All electrical installations should be inspected on a regular basis and on change of occupancy in order to keep up to date with frequent changes in safety regulations. Further information can be obtained from a suitably qualified Electrical Contractor. |

| Gas | |
|-----------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |

| Fe Water, plumbing and bathroom fittings | |
|--|--|
| Repair category | 1 |
| Notes | No immediate action or repair is needed. |
| | It should be appreciated, however, that seals around baths/shower areas and sanitary fitments are frequently troublesome and require regular maintenance. Failure of seals can result in dampness/decay to adjoining/underlying areas. |

| Heating and hot water | |
|--|---|
| Repair category | 1 |
| Notes All central heating systems should be serviced annually to ensure that they rule efficiently and safely. | |

| Drainage | | |
|---------------------|--|--|
| Repair category 1 | | |
| Notes | There is no obvious surface evidence of blockage or leakage. | |

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| Structural movement | 1 |
|---------------------------------------|---|
| Dampness, rot and infestation | 1 |
| Chimney stacks | 1 |
| Roofing including roof space | 1 |
| Rainwater fittings | 1 |
| Main walls | 1 |
| Windows, external doors and joinery | 1 |
| External decorations | 1 |
| Conservatories/porches | - |
| Communal areas | 1 |
| Garages and permanent outbuildings | - |
| Outside areas and boundaries | 1 |
| Ceilings | 1 |
| Internal walls | 1 |
| Floors including sub-floors | 1 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces | 1 |
| Internal decorations | 1 |
| Cellars | - |
| Electricity | 1 |
| Gas | - |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water | 1 |
| Drainage | 1 |

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| 1. Which floor(s) is the living accommodation on? | Ground |
|--|----------|
| 2. Are there three steps or fewer to a main entrance door of the property? | Yes X No |
| 3. Is there a lift to the main entrance door of the property? | Yes No X |
| 4. Are all door openings greater than 750mm? | Yes No X |
| 5. Is there a toilet on the same level as the living room and kitchen? | Yes X No |
| 6. Is there a toilet on the same level as a bedroom? | Yes X No |
| 7. Are all rooms on the same level with no internal steps or stairs? | Yes No X |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes X No |

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The subjects have been altered and extended over the years to provide their current levels of accommodation. The purchasing Solicitor should ensure that all necessary Consents in connection with these works have been obtained.

The sellers have advised that the drainage is to a private system. The system has not been inspected and condition, legal and environmental issues have not been investigated. For the purposes of the valuation, all are assumed to be satisfactory.

Estimated reinstatement cost for insurance purposes

The subjects should be covered for a sum of not less than £350,000 (THREE HUNDRED AND FIFTY THOUSAND POUNDS).

Valuation and market comments

In my opinion the market value of the non feudal interest in the property with the benefit of vacant possession and all as above described would be fairly stated in the order of £240,000 (TWO HUNDRED AND FORTY THOUSAND POUNDS).

| Signed | Security Print Code [508792 = 9524] Electronically signed |
|----------------|---|
| Report author | Joseph Dowie |
| Company name | DM Hall |
| Address | Shed 26, Unit 34 City Quay, Camperdown Street, Dundee, DD1 3JA |
| Date of report | 26th August 2016 |

Mortgage Valuation Report



| Property Address | |
|---|--|
| Address Seller's Name Date of Inspection | CHERRYTREE COTTAGE, EASSIE, FORFAR, DD8 1ST Paul Phillipson-Masters 8th August 2016 |
| Property Details | |
| Property Type | X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks) |
| Property Style | Detached Semi detached X Mid terrace End terrace Back to back High rise block Low rise block Other (specify in General Remarks) |
| Does the surveyor bel e.g. local authority, mi | lieve that the property was built for the public sector, Yes X No ilitary, police? |
| Flats/Maisonettes only Approximate Year of 0 | No. of units in block |
| | |
| Tenure X Absolute Ownership | Leasehold Ground rent £ Unexpired years |
| Accommodation | |
| | 2 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 2 WC(s) 0 Other (Specify in General remarks) cluding garages and outbuildings) 146 m² (Internal) 190 m² (External) greater than 40%) X Yes No |
| Garage / Parking / G | Outbuildings |
| Single garage Available on site? | Double garage X Parking space No garage / garage space / parking space X Yes No |
| Permanent outbuilding | gs: |
| None apparent. | |

Mortgage Valuation Report

| Construction | | | | | | | |
|--|----------------|---------------------|-----------------------|------------------------|-----------------|-------------------|----------------|
| Walls | Brick | X Stone | Concrete | Timber frame | Other | (specify in Gen | eral Remarks) |
| Roof | Tile | X Slate | Asphalt | Felt | Other | (specify in Gen | eral Remarks) |
| Special Risks | | | | | | | |
| Has the property s | suffered struc | tural moveme | nt? | | | X Yes | No |
| If Yes, is this rece | | | | | | Yes | X No |
| Is there evidence, immediate vicinity | | ason to anticip | oate subsidence | , heave, landslip o | or flood in the | Yes | X No |
| If Yes to any of the | e above, prov | vide details in o | General Remark | S. | | | |
| Service Connec | tions | | | | | | |
| Based on visual ir of the supply in G | | | ces appear to be | e non-mains, pleas | se comment o | on the type a | nd location |
| Drainage | Mains | X Private | None | Water | X Mains | Private | None |
| Electricity | X Mains | Private | None | Gas | Mains | Private | X None |
| Central Heating | X Yes | Partial | None | | | | |
| Brief description of | of Central Hea | ating: | | | | | |
| Oil fired boiler to | radiators. | | | | | | |
| Site | | | | | | | |
| | use to be ver | ified by the ee | | ana provida a bria | fdooorintion | in Conorol D | omorko |
| Apparent legal iss | X Shared driv | - | | amenities on separate | | ed service conn | |
| Ill-defined boundar | | | ural land included wi | | | r (specify in Ger | |
| | | 3 | | . 1 | | | |
| Location | | | | | | | |
| Residential suburb | | sidential within to | | ed residential / comme | | ly commercial | |
| X Commuter village | Re | mote village | Isola | ated rural property | Othe | r (specify in Ger | ieral Remarks) |
| Planning Issues | S | | | | | | |
| Has the property I | been extende | d / converted | / altered? X | Yes 🗌 No | | | |
| If Yes provide det | ails in Genera | al Remarks. | | | | | |
| Roads | | | | | | | |
| Made up road | Unmade roa | ad Partly | completed new road | Pedestrian a | access only | X Adopted | Unadopted |

General Remarks

The subjects are situated within the hamlet of Eassie which lies some 10 miles to the southwest of Forfar on the south side of the A94 Forfar/Coupar Angus road. Surrounding residential properties are of mixed age, size and character. Basic amenities can be found within the immediate area, others are readily accessible in Forfar and Dundee, both of which are within easy commuting distance.

From our limited inspection, the subjects were found to have been maintained in good order, consistent with their age and character. Whilst there are works requiring attention, these are of a type commonly found in properties of this age and should be capable of remedy by routine maintenance.

Evidence of previous movement was noted in the property, but within the limitations of our inspection, we found no evidence to suggest that the movement appears serious or that there were obvious signs of recent movement having occurred. It is our opinion that this evidence would not have an adverse effect on future saleability.

The subjects have been altered and extended over the years to provide their current levels of accommodation. The purchasing Solicitor should ensure that all necessary Consents in connection with these works have been obtained.

There is a mutual footpath to the rear of the property and our valuation assumes that all necessary Rights of Access are in force.

The vendors advise that the subjects are connected to a private drainage system. The system has not been inspected and condition, legal and environmental issues have not been investigated. For the purposes of the valuation, all are assumed to be satisfactory.

Essential Repairs

| None apparent. | | | |
|---------------------------------------|----------------------------|------|----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| Estimated cost of essential repairs £ | Retention recommended? Yes | X No | Amount £ |

Mortgage Valuation Report

Comment on Mortgageability

Satisfactory security for mortgage lending.

| Valuations | |
|---|-----------|
| Market value in present condition | £ 240,000 |
| Market value on completion of essential repairs | £ |
| Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) | £ 350,000 |
| Is a reinspection necessary? | Yes X No |
| Buy To Let Cases | |
| What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? | £ |
| Is the property in an area where there is a steady demand for rented accommodation of this type? | Yes No |

| Declaration | |
|-----------------------------|--|
| Signed | Security Print Code [508792 = 9524] Electronically signed by:- |
| Surveyor's name | Joseph Dowie |
| Professional qualifications | BSc MRICS |
| Company name | DM Hall |
| Address | Shed 26, Unit 34 City Quay, Camperdown Street, Dundee, DD1 3JA |
| Telephone | 01382 873100 |
| Fax | 01382 873 109 |
| Report date | 26th August 2016 |

Energy Performance Certificate (EPC)

Scotland

Dwellings

CHERRYTREE COTTAGE, EASSIE, FORFAR, DD8 1ST

| Dwelling type: | Mid-terrace house |
|---------------------------|------------------------------|
| Date of assessment: | 08 August 2016 |
| Date of certificate: | 24 August 2016 |
| Total floor area: | 141 m ² |
| Primary Energy Indicator: | 323 kWh/m ² /year |

Reference number: Type of assessment: Approved Organisation: Main heating and fuel:


9216-7628-5000-0618-9902 RdSAP, existing dwelling Elmhurst Boiler and radiators, oil

You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

| Estimated energy costs for your home for 3 years* | £5,718 | See your recommendations |
|---|--------|--------------------------------|
| Over 3 years you could save* | £2,838 | report for more information |

 * based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

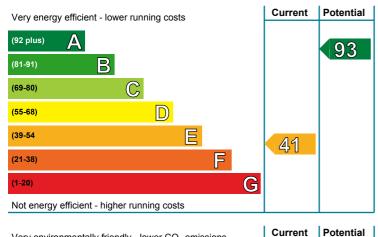

Very environmentally friendly - lower CO₂ emissions

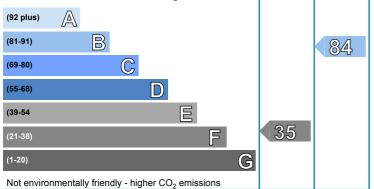

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (41)**. The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (35)**. The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years | Available with Green Deal |
|--|------------------|---------------------------------|------------------------------|
| 1 Room-in-roof insulation | £1,500 - £2,700 | £1824.00 | Ø |
| 2 Internal or external wall insulation | £4,000 - £14,000 | £354.00 | \bigcirc |
| 3 Floor insulation (suspended floor) | £800 - £1,200 | £159.00 | |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE **DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

CHERRYTREE COTTAGE, EASSIE, FORFAR, DD8 1ST 24 August 2016 RRN: 9216-7628-5000-0618-9902

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|--|-------------------|---------------|
| Walls | Sandstone or limestone, as built, no insulation (assumed) | ***** | ★★☆☆☆ |
| Roof | Roof room(s), ceiling insulated | ★★☆☆☆ | ★★☆☆☆ |
| Floor | Solid, no insulation (assumed) Suspended, no insulation (assumed) | | |
| Windows | Fully double glazed | **** | ★★★★☆ |
| Main heating | Boiler and radiators, oil | ★★★☆☆ | ★★★☆☆ |
| Main heating controls | Programmer, TRVs and bypass | ★★★☆☆ | ★★★☆☆ |
| Secondary heating | Room heaters, dual fuel (mineral and wood) | — | |
| Hot water | From main system | ★★★☆☆ | ★★★☆☆ |
| Lighting | Low energy lighting in all fixed outlets | **** | **** |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 84 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 12 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 8.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

| Estimated energy costs for this home | | | | | |
|--------------------------------------|----------------------|------------------------|--------------------------|--|--|
| | Current energy costs | Potential energy costs | Potential future savings | | |
| Heating | £4,896 over 3 years | £2,163 over 3 years | | | |
| Hot water | £588 over 3 years | £483 over 3 years | You could | | |
| Lighting | £234 over 3 years | £234 over 3 years | save £2,838 | | |
| Totals | £5,718 | £2,880 | over 3 years | | |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures | | Indicative cost | Typical saving | Rating after | Green | |
|----------------------|---|-------------------|----------------|--------------|-------------|------|
| | | indicative cost | per year | Energy | Environment | Deal |
| 1 | Room-in-roof insulation | £1,500 - £2,700 | £608 | D 60 | E 51 | Ø |
| 2 | Internal or external wall insulation | £4,000 - £14,000 | £118 | D 64 | D 55 | Ø |
| 3 | Floor insulation (suspended floor) | £800 - £1,200 | £53 | D 65 | D 57 | Ø |
| 4 | Floor insulation (solid floor) | £4,000 - £6,000 | £32 | D 66 | D 59 | |
| 5 | Upgrade heating controls | £350 - £450 | £50 | D 68 | D 61 | |
| 6 | Replace boiler with new condensing boiler | £2,200 - £3,000 | £48 | C 69 | D 63 | |
| 7 | Solar water heating | £4,000 - £6,000 | £38 | C 71 | D 65 | |
| 8 | Solar photovoltaic panels, 2.5 kWp | £5,000 - £8,000 | £252 | C 78 | C 71 | |
| 9 | Wind turbine | £15,000 - £25,000 | £552 | A 93 | B 84 | |

Measures which have a green deal tick \bigcirc are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick \bigcirc may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide longlasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that planning permission might be required and that building regulations apply to this work so it is best to check with your local authority whether a building warrant or planning permission will be required.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

4 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check this with your local authority building standards department.

5 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified heating engineer.

6 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified heating engineer.

7 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

8 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

9 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|------------------------------------|
| Space heating (kWh per year) | 26,987 | N/A | N/A | (1,691) |
| Water heating (kWh per year) | 3,517 | | | |

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

| Assessor's name: | Mr. Joseph Dowie |
|-----------------------------|---|
| Assessor membership number: | EES/009364 |
| Company name/trading name: | D M Hall Chartered Surveyors LLP |
| Address: | Shed 26, Unit 34 City Quay Camperdown Street Dundee DD1 3JA |
| Phone number: | 01382 873100 |
| Email address: | joseph.dowie@dmhall.co.uk |
| Related party disclosure: | No related party |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.



| Property address CHERRY TREE HOUSE, EASSIE, FORFAR, ANGUS, DD8 1ST |
|--|
|--|

| Seller(s) | Paul and Leah Phillipson-Masters |
|-----------|----------------------------------|
|-----------|----------------------------------|

| Completion date of property questionnaire | 9 August 2016 |
|---|---------------|
|---|---------------|

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

| 1. | Length of ownership |
|----|---|
| | How long have you owned the property? 13 years |
| 2. | Council tax |
| | Which Council Tax band is your property in? (Please circle) A B C D E F G H |
| 3. | Parking |
| | What are the arrangements for parking at your property? |
| | (Please tick all that apply) |
| | • Garage |
| | Allocated parking space |
| | • Driveway 🗸 |
| | Shared parking |
| | On street |
| | Resident permit |
| | Metered parking |
| | Other (please specify): |
| 4. | Conservation area |
| | Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? |

| Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical | Yes / No | | | | |
|--|--|--|--|--|--|
| interest)? | | | | | |
| Alterations/additions/extensions | | | | | |
| (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes</u>, please describe below the changes which you have made: | | | | | |
| (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for | ¥es / Ne | | | | |
| checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: | | | | | |
| Have you had replacement windows, doors, patio doors or double glazing installed in your property? | Yes / No | | | | |
| If you have answered yes, please answer the three questions below: | | | | | |
| (i) Were the replacements the same shape and type as the ones you replaced? | Yes / No | | | | |
| (ii) Did this work involve any changes to the window or door openings? | Yes / No | | | | |
| (iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed): | | | | | |
| All windows and doors replaced with high quality double glazed timber units - approx. 20 | 010/11 | | | | |
| Please give any guarantees which you received for this work to your solicitor or ea | state agent. | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made: (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below: (i) Were the replacements the same shape and type as the ones you replaced? (ii) Did this work involve any changes to the windows, doors or patio doors (w dates when the work was completed): All windows and doors replaced with high quality double glazed timber units - approx. 20 | | | | |

| 7. | Central heating | | | | |
|----|---|--------------------------------|--|--|--|
| a. | Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom). | | | | |
| | If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). | | | | |
| | Oil-fired | | | | |
| | If you have answered yes, please answer the three questions below: | | | | |
| b. | When was your central heating system or partial central heating system installed? | 2003 | | | |
| C. | Do you have a maintenance contract for the central heating system? | Yes / No | | | |
| | If you have answered yes, please give details of the company with which you have a maintenance contract: | | | | |
| d. | When was your maintenance agreement last renewed? (Please provide the month and year). | | | | |
| 8. | Energy Performance Certificate | | | | |
| | Does your property have an Energy Performance Certificate which is less than 10 years old? | Yes / No | | | |
| 9. | Issues that may have affected your property | | | | |
| a. | Has there been any storm, flood, fire or other structural damage to your property while you have owned it? | Yes / No | | | |
| | If you have answered yes, is the damage the subject of any outstanding insurance claim? | Yes / No | | | |
| b. | Are you aware of the existence of asbestos in your property? | ¥es / No | | | |
| | If you have answered yes, please give details: | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |

| P | ease tick which services are connected to your property and give details of the pplier: | | | | | |
|----------|---|--------------------|------------------------------|---|--|--|
| | Services Connected Supplier | | | | | |
| | Gas / liquid petroleum gas | _ | | | | |
| | Water mains / private water supply | ~ | Scottish Water | | | |
| | Electricity | ~ | Hydro Electric | | | |
| | Mains drainage | ~ | Scottish Water | | | |
| | Telephone | ~ | BT | | | |
| | Cable TV / satellite | — | | | | |
| | Broadband | ~ | ВТ | | | |
| | | | | | | |
| | there a septic tank system at yo you have answered yes, please | | questions below: | Yes / No | | |
| (i) |) Do you have appropriate conse | ents for the disch | narge from your septic tank? | Yes / No / Don't knov | | |
| (ii | i) Do you have a maintenance co | ontract for your s | eptic tank? | Yes / No | | |
| lf ha | you have answered yes, pleas ave a maintenance contract: | e give details of | the company with which you | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |

| 11. | Responsibilities for Shared or Common Areas | |
|-----|---|--|
| a. | Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? | Yes / No / Den't Knew |
| | If you have answered yes, please give details: | |
| b. | Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? | Yes / No / Not applicablo |
| | If you have answered yes, please give details: | |
| | Two bedrooms in property share roof with neighbouring property. | |
| C. | Has there been any major repair or replacement of any part of the roof during the time you have owned the property? | ¥es / No |
| d. | Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? | Yes / No |
| | If you have answered yes, please give details: | |
| e. | As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? | ¥es / No |
| | If you have answered yes, please give details: | |
| f. | As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) | Yes / No |
| | If you have answered yes, please give details: | |
| 12. | Charges associated with your property | |
| a. | Is there a factor or property manager for your property? | Yes / No |
| | If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

| b. | Is there a common buildings insurance policy? | Yes / No / Den't Knew | | |
|-----|--|-------------------------------------|--|--|
| | If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? | | | |
| C. | Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. | | | |
| 13. | Specialist works | | | |
| a. | As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? | Yes / No | | |
| | If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property: | | | |
| | Woodworm treatment carried out before property was purchased - approx. 2002. Property checked since then and given all clear. | | | |
| b. | As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? | Yes / No | | |
| | If you have answered yes, please give details: | | | |
| C. | If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? | Yes / No | | |
| | If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. | | | |
| | Guarantees are held by: | | | |
| | No guarantees for work were given when property was purchased in 2002. | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |

| 14. | Guarantees | | | | | | |
|-------|--|---------------------|-----------|-------------------------------------|------------------------|------|-----------------------------|
| a. | Are there any guarantees or warranties for any of the following: | | | | | | |
| (i) | Electrical work | No | ¥es | Don't know | With title deeds | Lost | Cannot Answor* |
| (ii) | Roofing | No | ¥es | Don't know | With title deeds | Lost | Cannot Answor* |
| (iii) | Central heating | No | ¥es | Don't know | With title deeds | Lost | Cannot Answor* |
| (iv) | NHBC | No | ¥es | Don't know | With title deeds | Lost | Cannot Answor* |
| (v) | Damp course | No | ¥es | Don't know | With title deeds | Lost | Cannot Answor* |
| (vi) | Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) | No | ¥es | Don't know | With title deeds | Lost | Cannot Answor* |
| b. | If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela | s', pleas te(s): | e give de | etails of t | he work | | |
| C. | Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: | | | | | ¥œ | s / No |
| 15. | Boundaries | | | | | | |
| | So far as you are aware, has any boundary o last 10 years? | f your pr | operty b | een move | ed in the | | / No / t know |
| | If you have answered yes, please give details | : | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

| 16. | Notices that affect your property | |
|-----|---|--|
| | In the past 3 years have you ever received a notice: | |
| a. | advising that the owner of a neighbouring property has made a planning application? | Yes / No / Don't know |
| b. | that affects your property in some other way? | ¥es / No / Don't know |
| c. | that requires you to do any maintenance, repairs or improvements to your property? | Yes / No / Don't know |
| | If you have answered yes to any of a-c above, please give the notices to your solicitor or e agent, including any notices which arrive at any time before the date of entry of the purchas your property. | |

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):

Date: