1 RAMSAY PLACE

PORTOBELLO WEST

EDINBURGH

EH15 1JA



# **Home Report**

shepherd.co.uk



All Angles Covered



**Energy Performance Certificate** 



## **Energy Performance Certificate (EPC)**

**Dwellings** 

## **Scotland**

### 3F1, 1 RAMSAY PLACE, PORTOBELLO WEST, EDINBURGH, EH15 1JA

Dwelling type: Top-floor flat
Date of assessment: 14 January 2025
Date of certificate: 15 January 2025

Total floor area: 40 m<sup>2</sup>

Primary Energy Indicator: 360 kWh/m²/year

**Reference number:** 0120-2624-9090-2295-2181 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

**Main heating and fuel:** Boiler and radiators, mains


gas

#### You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,514	See your recommendations
Over 3 years you could save*	£354	report for more information

<sup>\*</sup> based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

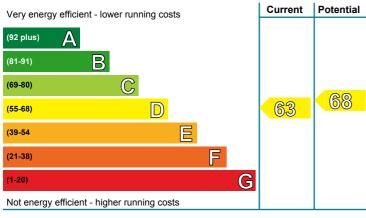


### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

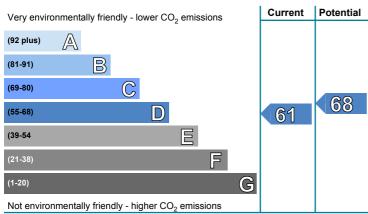

### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£315.00
2 Low energy lighting	£10	£42.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	****	***
	Solid brick, as built, no insulation (assumed)	****	***
Roof	Pitched, no insulation (assumed)	****	$\star$ $\dot{\sim}$ $\dot{\sim}$ $\dot{\sim}$
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	****	<b>★★★</b> ☆
Main heating	Boiler and radiators, mains gas	****	<b>★★★</b> ☆
Main heating controls	Programmer, room thermostat and TRVs	****	<b>★★★</b> ☆
Secondary heating	None	_	_
Hot water	From main system	****	*** <b></b>
Lighting	Low energy lighting in 67% of fixed outlets	****	*** <b></b>

### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 63 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,055 over 3 years	£1,746 over 3 years	
Hot water	£273 over 3 years	£273 over 3 years	You could
Lighting	£186 over 3 years	£141 over 3 years	save £354
Totals	£2,514	£2,160	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Da	and the second s	Indiantive and	Typical saving	Rating after improvement	
Re	ecommended measures	easures Indicative cost per		Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£105	D 67	D 67
2	Low energy lighting for all fixed outlets	£10	£14	D 68	D 68

### Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	8,413	(4,061)	N/A	(2,007)
Water heating (kWh per year)	1,417			

### Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Alexander Lamb

Assessor membership number: EES/024326
Company name/trading name: J & E Shepherd
Address: 12 Atholl Crescent

Edinburgh EH3 8HA

Phone number: 0131 225 1234

Email address: edinburgh@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Scottish
Single Survey



## survey report on:

Property address	3F1 1 RAMSAY PLACE PORTOBELLO WEST EDINBURGH EH15 1JA		
Customer	Ms N Chandler		
Customer address	3F1 1 Ramsay Place Portobello West Edinburgh EH15 1JA		
Prepared by	J & E Shepherd		
Date of inspection	14th January 2025		
-			



### PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report <sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

### 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

#### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose built top floor flat within a four storey residential block.	
Accommodation	Third Floor: Entrance hall, living room/kitchen, bedroom, shower room and wc compartment.	
Gross internal floor area (m²)	40m2 or thereby.	
Neighbourhood and location	The subjects comprise a purpose built top floor flat located within Edinburgh's established Portobello district located to the east of Edinburgh City Centre being convenient for local shopping, social, educational and transport facilities.	
Age	1890 approx.	
Weather	Dry and clear.	
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.	
	The chimney stacks are of rendered brick construction.	
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.  Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.	
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.  If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.	

	The roof is pitched and overlaid in slate incorporating a central valley gutter. No access was afforded into the roof void or onto decks at the time of inspection.
	[
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of traditional solid stone work being pointed externally with the gable elevation being rendered.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows throughout are of replacement UPVC double glazed style. The front access door and the access doors to the communal stair are of a timber variety.
External decorations	Visually inspected.
	Painted and UPVC finishes.
Conservatories / porches	Visually inspected.
	None.
Communal areas	Circulation areas visually inspected
Communal areas	Circulation areas visually inspected.
	There is a communal entrance hall and stairwell secured by an entryphone system.
Garages and permanent outbuildings	Visually inspected.
	None.

Outside areas and boundaries	Visually inspected.  The subjects benefit from an area of communal garden ground to the rear of the block. The boundaries, where defined, are of
	pointed brick and stone walls.
Ceilings	Visually inspected from floor level.
	Plastered ceilings.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Plaster finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	The flooring throughout is of suspended timber construction. There are fitted floor coverings throughout.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors, skirtings and facings are of a timber variety. The kitchen is comprised of wall and base mounted units incorporating adequate storage and worktop surface areas.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	Blocked over.
Internal decorations	Visually inspected.
	Painted and papered throughout.
Cellars	Visually inspected where there was a safe and purpose-built access.
İ	
	None.

Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.  Mains supply.	
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.	
	Mains supply.	
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.	
	No tests whatsoever were carried out to the system or appliances.	
	Mains supply. The plumbing, where seen, is of copper supply pipes and PVC waste pipes, however, due to the age of the property it is possible that some section of lead plumbing still exist in concealed areas. The sanitary arrangements comprise a two piece suite in the shower room and a two piece suite in the wc compartment.	
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.	
	No tests whatsoever were carried out to the system or appliances.	
	The property benefits from a gas fired central heating system serving steel panel radiators with the combination boiler wall mounted within the kitchen. There are electric radiators present within the wc compartment and the shower room. It would appear domestic hot water is off the central heating system.	
Drainage	Drainage covers etc. were not lifted.	
Dramage		
	Neither drains nor drainage systems were tested.	
	Presumed to main public sewer.	
Fire, smoke and burglar alarms	Visually inspected.	
	No tests whatsoever were carried out to the system or appliances.	
	All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be	

installed in each kitchen. The alarms need to be ceiling mounted

and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

### Any additional limits to inspection

#### For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.

Windows and external doors were not all fully opened or tested.


No access was available to any sub-floor areas.

No access was afforded into the roof void or onto decks at the time of inspection.

At the time of inspection conditions were dry.

The external fabric of the building was seen from restricted ground floor views only.

### Sectional Diagram showing elements of a typical house

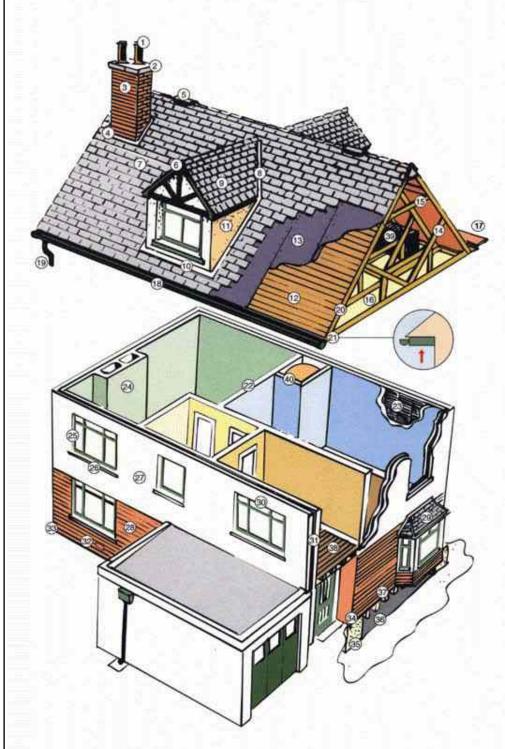

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9 Dormer projection
- (10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- Window sills
- (27) Rendering
- (28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 9) Water tank
- 40) Hot water tank

### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	The property has suffered previous structural movement evident through to distortions to the internal and external fabric of the building. On the basis of a single visual survey, this would appear to be of longstanding and non progressive nature with no evidence of recent movement apparent.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range. We have presumed that those areas not inspected are free of defects.  Staining noted to the ceiling within the bedroom, however, this was dry when tested.

Chimney stacks	
Repair category	1
Notes	Our inspection of chimneys was limited but they are of an age and style where a degree of regular ongoing maintenance should be anticipated.

Roofing including roof space	
Repair category	2
Notes	No inspection was possible of the roof due to the lie of the land, however, it is now of an age and style where a degree of regular and ongoing maintenance and repair should be anticipated and budgeted for.  Valley gutterings should be regularly cleared to prevent a build up of debris. We always recommend a precautionary check of the roof and pertinents is undertaken prior to purchase especially after adverse weather conditions.

Rainwater fittings	
Repair category	2
Notes	Corrosion and vegetation noted to the rainwater goods. Ongoing maintenance and repair should be anticipated.  We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category	2
Notes	Sections of worn and damaged stone work noted. Ongoing maintenance and repair should be anticipated.

Windows, external doors and joinery	
Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.  A precautionary check of all windows and doors is always recommended prior to purchase.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	2
Notes	Staining noted to the ceiling within the communal stairwell, however, this was unable to be tested.

Communal areas leading to and surrounding the subject property have been
visually inspected where possible, however it should be appreciated that there
may be a common repairing liability in respect of other parts of the building out
with the scope of our inspection and this should be confirmed.
·

Garages and permanent outbuildings	
Repair category	-
Notes	None.

Outside areas and boundaries	
Repair category	2
Notes	The boundary wall is weathered and damaged in areas. Ongoing maintenance and repair should be anticipated and budgeted for.

Ceilings	
Repair category	1
Notes	Plaster cracking noted.

Internal walls	
Repair category	1
Notes	Plaster cracking noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.  Slopes and uneven flooring noted. We recommend that any loose or uneven flooring be reaffixed in accordance with good maintenance practice.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	1
Notes	The fireplaces have been blocked over. It is assumed that the chimneys are adequately vented with the chimneys capped. Ventilators should be fitted to prevent the build-up of dampness within the chimney flue.

Internal decorations	
Repair category	1
Notes	The property is in reasonable decorative order.

Cellars	
Repair category	-
Notes	None.

Electricity	
Repair category	1
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.  It was advised by the vendor that the consumer unit was upgraded in 2022 and the system checked at this time. Any documentation pertaining to this should be made available prior to purchase.  A precautionary check of the electrical system is always recommended prior to purchase. No tests were carried out by this firm.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be

regularly checked and replaced, to prevent water damage to adjoining areas.
We presume the sealants around the sanitary fittings are functional and no defects are present to the adjacent areas. A precautionary check of the areas below and adjacent to the sanitary fittings is always recommended prior to purchase as these areas are prone to leakage.

Heating and hot water				
Repair category	1			
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.  A number of the radiators are of a more dated style and future upgrading should be anticipated and budgeted for.  A precautionary check is always recommended prior to purchase. No tests were carried out by this firm.			

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.  A precautionary check of the drainage system is always recommended prior to purchase. No tests were carried out by this firm.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

### 3. Accessibility information

### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Third
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

Rights of access, land ownership and maintenance liabilities should be confirmed by an inspection of the Title Deeds.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

The property has been altered to form the present accommodation and it should be confirmed that all required Local Authority documentation has been obtained. Whilst not an exhaustive list, this includes the relocation of the kitchen and the formation of the internal shower room.

### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £160,000 (One Hundred and Sixty Thousand Pounds Sterling). This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

#### Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £155,000 (One Hundred and Fifty Five Thousand Pounds Sterling).

Signed	Security Print Code [510894 = 6338 ] Electronically signed	
Report author	Alex Lamb	
Company name	J & E Shepherd	
Address	12 Atholl Crescent, Edinburgh, EH3 8HA	

Date of report	15th January 2025
----------------	-------------------



Property Address	
Address Seller's Name Date of Inspection	3F1, 1 RAMSAY PLACE, PORTOBELLO WEST, EDINBURGH, EH15 1JA Ms N Chandler 14th January 2025
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette  Purpose built flat Converted flat X Tenement flat Flat over non-residential use  Other (specify in General Remarks)
Property Style	□ Detached       □ Semi detached       □ Mid terrace       □ End terrace         □ Back to back       □ High rise block       ▼ Low rise block       □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes onl	No. of units in block 11
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
•	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 1 WC(s) 0 Other (Specify in General remarks) Cluding garages and outbuildings) 40 m² (Internal) m² (External)  greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?  Permanent outbuildin	Double garage Parking space X No garage / garage space / parking space Yes No
None.	

Construction							
Walls	Brick	X Stone	Concrete	Timber frame	Other	(specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Other	(specify in Gen	eral Remarks)
Special Risks							
Has the property	suffered struc	tural movem	ent?			X Yes	No
If Yes, is this rece	nt or progres	sive?				Yes	X No
Is there evidence, immediate vicinity		ason to antic	cipate subsidence	e, heave, landslip o	or flood in the	Yes	X No
If Yes to any of th	e above, prov	vide details in	General Remar	ks.			
Service Connec	ctions						
Based on visual ir of the supply in G			rices appear to be	e non-mains, pleas	se comment o	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description of	of Central Hea	ating:					
Gas fired system	n serving radi	ators.					
Site							
Apparent legal iss	sues to be ver	ified by the c	onveyancer. Ple	ase provide a brie	f description	in General R	emarks.
Rights of way		ves / access		· · amenities on separate	·	ed service conn	
Ill-defined boundar	ries	Agricu	Itural land included w	ith property	Othe	er (specify in Ger	neral Remarks)
Location							
Residential suburb	X Re	sidential within t	own / city	ed residential / commer	rcial Main	ly commercial	
Commuter village	Re	mote village	Isol	ated rural property	Othe	er (specify in Ge	neral Remarks)
Planning Issues	S						
Has the property I If Yes provide det			d / altered?	Yes No			
Roads							
X Made up road	Unmade roa	nd Partly	completed new road	d Pedestrian a	ccess only	Adopted	Unadopted

General Remarks
At the time of inspection the property appeared in a condition generally consistent with one of its age and type of construction.
Ongoing maintenance and repair should be anticipated to the external fabric of the building in accordance with good maintenance practice.
The property has been altered to form the present accommodation and it should be confirmed that all required Local Authority documentation has been obtained. Whilst not an exhaustive list, this includes the relocation of the kitchen and the formation of the internal shower room.
The property has suffered previous structural movement, however, this appears to be of a longstanding and non progressive nature given the limitations of a single visual survey.
Essential Repairs
None.

Comment on Mortgageability				
The property forms suitabl mortgage provider.	e security for mortgage purposes subject to the specific lending criteria o	f any		
Valuations				
Market value in present condition  Market value on completion of essential repairs  Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)  Is a reinspection necessary?  L 155,000  £ 160,000  Tyes XI				
Buy To Let Cases				
month Short Assured Tenar	•	£		
is the property in an area w	here there is a steady demand for rented accommodation of this type?	∐ Yes ∐ No		
Declaration				
Signed	Security Print Code [510894 = 6338 ] Electronically signed by:-			
Surveyor's name	Alex Lamb			
Professional qualifications	BSC MRICS			
Company name	J & E Shepherd			
Address	12 Atholl Crescent, Edinburgh, EH3 8HA			
Telephone 0131 225 1234				
Fax				
Report date	15th January 2025			



Property Questionnaire



Property address	1/9 Ramsay Place Edinburgh EH15 1JA
Seller(s)	Naomi Chandler
Completion date of property questionnaire	13/01/2025

### **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

### Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? 4 years					
2.	Council tax					
	Which Council Tax band is your property in? (Please tick one)  ☐ A ☐ B ☐ C ☐ D ☐ E ☐ F ☐ G ☐ H					
3.	Parking					
	What are the arrangements for parking at your property?  (Please tick all that apply)					
	• Garage					
	Allocated parking space					
	• Driveway					
	Shared parking					
	On street					
	Resident permit					
	Metered parking					
	Other (please specify):					
4.	Conservation area					
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	☐ Yes ☐ No ☑ Don't know				

5.	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☐ No	
6.	Alterations/additions/extensions		
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☐ Yes ☑ No	
	If you have answered yes, please describe below the changes which you have made:		
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ Yes	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.		
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:		
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	☐ Yes ⊠ No	
	If you have answered yes, please answer the three questions below:	2,	
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ Yes ☐ No	
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☐ No	
	(iii) Please describe the changes made to the windows doors, or patic approximate dates when the work was completed):	o doors (with	
Please give any guarantees which you received for this work to your solicitor of agent.			

7.	Central heating	
a.	Is there a central heating system in your property?  (Note: a partial central heating system is one which does not heat all the main rooms of the property —  the main living room, the bedroom(s), the hall and the bathroom).  If you have answered yes or partial — what kind of central heating is there?  (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).  Gas cental heating  If you have answered yes, please answer the three questions below:	☐ Yes ☐ No ☐ Partial
	<ul><li>(i) When was your central heating system or partial central heatinstalled?</li><li>Boiler installed September 2021</li></ul>	ng system
	(ii) Do you have a maintenance contract for the central heating system?  If you have answered yes, please give details of the company with which you have a maintenance contract:  British Gas	⊠ Yes □ No
	(iii) When was your maintenance agreement last renewed? (Pleas month and year).  April 2024	e provide the
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☐ Yes ☐ No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?  If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☑ No ☐ Yes ☐ No
b.	Are you aware of the existence of asbestos in your property?  If you have answered yes, please give details:	☐ Yes ☑ No

10.	Services						
a. Pl	Please tick which services are connected to your property and give details of the supplier:						
	Services						
	Gas or liquid petroleum gas	Yes	British Gas	ater mains			
	Water mains or private water supply	Yes	Water main				
	Electricity	Yes	Octopus				
	Mains drainage	Yes					
	Telephone	No					
	Cable TV or satellite	No					
	Broadband Yes Virgin Mo		Virgin Med	dia			
-				_			
b.	Is there a septic tank system a	at your property?		Yes			
	If you have answered yes, plea	ions below:	⊠ No				
	(iv) Do you have appropriat your septic tank?	☐ Yes ☐ No ☐ Don't Know					
	(v) Do you have a mainten.  If you have answered yes, plea which you have a maintenance	☐ Yes ☐ No					

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?  If you have answered yes, please give details:	☐ Yes ☑ No ☐ Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?  If you have answered yes, please give details:  Cleaning of stairwell and any repairs (no current repairs needed)	<ul><li>         ∑ Yes         ☐ No         ☐ Not applicable         </li></ul>
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes ☑ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?  If you have answered yes, please give details:	☐ Yes ☑ No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?  If you have answered yes, please give details:	☐ Yes ☑ No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privatelyowned.)  If you have answered yes, please give details:	☐ Yes ☑ No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?  If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:  Theres no factor but the owners of all the properties have an email group for dealing with cleaning charges and any maintenance.	☐ Yes ☑ No

b.	Is there a common buildings insurance policy?	☐ Yes
		⊠ No
		☐ Don't Know
	If you have answered yes, is the cost of the insurance included in	☐ Yes
	your monthly/annual factor's charges?	□ No
		☐ Don't Know
C.	Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a residents maintenance or stair fund.	
	Stair cleaning - paid yearly	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	☐ Yes ⊠ No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	☐ Yes ⊠ No
	If you have answered yes, please give details:	
c.	If you have answered yes to 13(a) or (b), do you have any	Yes
	guarantees relating to this work?	☐ No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work	$\boxtimes$				
(ii)	Roofing			$\boxtimes$		
(iii)	Central heating		$\boxtimes$			
(iv)	National House Building Council (NHBC)					
(v)	Damp course			$\boxtimes$		
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)					
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):  Boiler has a 5 year guarantee					
C.	Are there any outstanding claims under any of the guarantees listed above?  If you have answered yes, please give details:				☐ Yes ☑ No	
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years?  If you have answered yes, please give details:				☐ Yes ☑ No ☐ Don't know	

16.	Notices that	affect your proper	ty		
	In the past thre	e years have you ever	received a notice:		
a. advising that the owner of a neighbour planning application?		ring property has made a	☐ Yes ⊠ No		
b.	that affects you	r property in some oth	ier way?	☐ Yes ☑ No	
c.	that requires yo to your property	-	nce, repairs or improvements	☐ Yes ☑ No	
If you have answered yes to any of a-c above, please give the notices to your estate agent, including any notices which arrive at any time before the of the purchaser of your property.					
I/We	e confirm that	the information in	authorised body or perso		
of my	y/our knowled	ge and belief.			
Signa	ature(s):				
Date	:				

## shepherd.co.uk





**Home Report Valuation Report** Mortgage & Re-Mortgage Valuation **Executory Valuation Inheritance Tax Valuation Tax Valuation** Separation Valuation **Private Sale Valuation** 

New Build, Development & Plot Valuation

**Extension & Alteration Valuation Insurance Reinstatement Valuation** 

> **Portfolio Valuation Rental Valuation Driveby Valuation Desktop Valuation**

**Energy Performance Certificate (EPC) Level Two Survey & Valuation Report Level Two Condition Report Expert Witness Report Council Tax Appeal** 





**Commercial Valuation Commercial Agency Acquisitions & Disposals Commercial Lease Advisory Rent Reviews Asset Management Project Consultancy Development Appraisals Rating Commercial Property Auctions Property Management Professional Services** Licensed Trade / Leisure



**PROPERTY & CONSTRUCTION** CONSULTANTS



**Quantity Surveying Building Surveying Project Management Dispute Resolution Support Services Principal Designer** Clerk of Works **Commercial EPC Fire Engineering Health & Safety Management Employer's Agent Energy Department Housing Services Development Monitoring** 

**Mediation Services** 

Aberdeen △▲▲ 01224 202800

△▲ 01292 267987

Bearsden

Birmingham **△** 0121 270 2266

Coatbridge 

Cumbernauld △▲ 01236 780000

Dalkeith △▲ 0131 663 2780 **Dumbarton** 

△▲ 01389 731682

**Dumfries** 

△▲△ 01387 264333

Dundee

△▲ 01382 200454 △ 01382 220699

**Dunfermline** △ 01383 731841

**East Kilbride** △▲ 01355 248535

**Edinburgh** △▲ 0131 2251234 △ 0131 557 9300

Elgin

△▲ 01343 553939

△▲ 01324 635 999

Fraserburgh △▲ 01346 517456

**Galashiels** △▲ 01896 750150

Glasgow △△△ 0141 331 2807

**Glasgow South** △▲ 0141 649 8020

**Glasgow West End** 

Greenock △△01475 730717

Hamilton

△△01698 897548

**Inverness** △△△01463 712239

**Kilmarnock** △△01563 520318

Kirkcaldy △ <u>△</u> 01592 205442

Leeds △ 0113 322 5069

Livingston △ ▲ 01506 416777

London ▲△ 02033 761 236

Montrose △▲ 01674 676768

Motherwell △ △ 01698 252229

Musselburgh △ △ 0131 653 3456

△▲ 01631 707 800

**Paisley** △ ▲ 0141 889 8334

△▲ 01738 638188 △ 01738 631631

**Peterhead** △△ 01779 470766

St Andrews △▲ 01334 477773 △ 01334 476469

Saltcoats △▲ 01294 464228

Stirling △△ 01786 450438 △ 01786 474476