9 TAY STREET POLWARTH EDINBURGH EH11 1DZ



Home Report

shepherd.co.uk



All Angles Covered



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

9 TAY STREET, POLWARTH, EDINBURGH, EH11 1DZ

Dwelling type: Ground-floor flat
Date of assessment: 01 April 2025
Date of certificate: 02 April 2025
Total floor area: 82 mg

Total floor area: 82 m²

Primary Energy Indicator: 349 kWh/m²/year

Reference number: 1000-4690-0822-0003-1453 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,539	See your recommendations
Over 3 years you could save*	£2,316	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

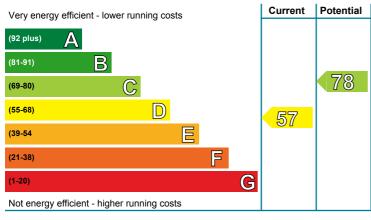


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

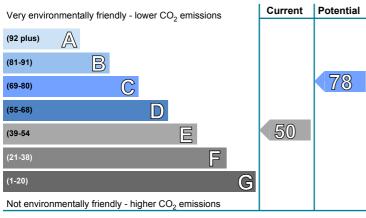

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (50)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1254.00
2 Floor insulation (suspended floor)	£800 - £1,200	£513.00
3 Heating controls (room thermostat)	£350 - £450	£129.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
Roof	(another dwelling above)	_	_
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	★★★☆☆
Main heating	Boiler and radiators, mains gas	****	★★★ ☆
Main heating controls	Programmer, TRVs and bypass	***	★★★ ☆☆
Secondary heating	None	_	_
Hot water	From main system	***	****
Lighting	Low energy lighting in 89% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 62 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,690 over 3 years	£1,494 over 3 years	
Hot water	£549 over 3 years	£429 over 3 years	You could
Lighting	£300 over 3 years	£300 over 3 years	save £2,316
Totals	£4,539	£2,223	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Baraman dad maaanaa		la disettus seet	Typical saving	Rating after improvement	
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£418	D 68	D 65
2	Floor insulation (suspended floor)	£800 - £1,200	£171	C 73	C 72
3	Upgrade heating controls	£350 - £450	£43	C 74	C 73
4	Replace boiler with new condensing boiler	£2,200 - £3,000	£140	C 78	C 78

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Micro CHP

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	12,113	N/A	N/A	(4,757)
Water heating (kWh per year)	2,126			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:
Assessor membership number:
Company name/trading name:
Address:

Mr. Darren Lewis
EES/016141
J & E Shepherd
12 Atholl Crescent

Edinburgh EH3 8HA

Phone number: 0131 225 1234

Email address: edinburgh@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Scottish
Single Survey



survey report on:

9 TAY STREET POLWARTH EDINBURGH EH11 1DZ
Estate of Sylvia Ross
9 Tay Street Polwarth Edinburgh EH11 1DZ
J & E Shepherd
1st April 2025



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a main door tenement flat.
Accommodation	Ground Floor: Entrance hall, living room, kitchen/dining room,box room bedroom and bathroom with wc.
Gross internal floor area (m²)	82m2 approx.
Neighbourhood and location	The subjects are situated within an established residential area of mixed style properties within the Polwarth area of Edinburgh and convenient for local shopping, educational and social facilities.
Age	1900 approx.
Weather	Dry and sunny.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. Masonry type chimney stacks present.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

	The roof appears to be pitched and slated with flat sections presumed clad with waterproof membrane.
	presumed dad with waterproof membrane.
Γ	T.,, ., .
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are built of traditional solid stonework pointed externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows throughout are of a mixed type with aluminium double glazed type units and UPVC double glazed type units. The front access door is of a timber variety.
External decorations	Visually inspected.
	Aluminium and UPVC type finishes.
Γ	
Conservatories / porches	None.
Communal areas	Circulation areas visually inspected
Communal areas	Circulation areas visually inspected.
	No access gained to common stair due to an entryphone system being in place.
Common and manner and a set of the first	None
Garages and permanent outbuildings	None.
Outside areas and boundaries	Visually inspected.
	The vendor has informed us the property benefits from the use of the communal gardens located to the rear elevation, however, this should be confirmed with the vendor prior to purchase. There is a small area of garden ground to the front elevation. The boundaries are of a mixed type.

Ceilings	Vigually inspected from floor level
Ceilings	Visually inspected from floor level.
	Presumed plaster finishes.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Presumed plaster finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	The floors throughout have fitted floor coverings.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen fittings are dated. The internal doors, skirtings and facings appear to be of a timber variety.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	The fireplace in the living room has been fitted with an electric fire.
Internal decorations	Visually inspected.
	Papered and painted throughout.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply with the fuseboard located in the hall cupboard.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply with the gas meter located in the hall cupboard.

Water, plumbing, bathroom fittings Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is from the mains supply. The plumbing, where seen, is of copper and lead piping with a PVC cold water storage tank located in the tank cupboard above the bathroom. The sanitary fittings are located within the bathroom. Heating and hot water Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. The property benefits from a gas fired central heating system with the gas boiler located within the kitchen/dining room cupboard. This boiler appears to provide hot water. An electric fire is present in the living room. Drainage Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Presumed to main public sewer. Fire, smoke and burglar alarms Visually inspected. No tests whatsoever were carried out to the system or appliances. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership. Any additional limits to inspection For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general

condition and standard of maintenance.

The property was fully floor covered at the time of inspection. No access was gained to any sub floor areas. No access was gained to the area below the sanitary fittings. No access was gained to the common stair due to an entryphone system being in place. The roof decks were unseen due to the position of the dwelling. The chimneys were partially seen. The roof and rainwater goods were not monitored under wet weather conditions. At the time of inspection conditions were dry. The services were not tested. The heating system was not tested. No access was gained to the rear elevation due to the lack of an access door and as such we presume for the purposes of this report, the rear elevation areas are free of defects.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- (21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- (25) Window pointing
- 26) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 8 Floorboards
- 9) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movemen	nt
Repair category	1
Notes	Structural movement was noted to the subject property. This appears to be of longstanding and non progressive nature.

Dampness, rot and infestation	
Repair category	2
Notes	Unacceptable levels of dampness were noted to be affecting sections of the walls and ceilings in the subject property and the ceiling within the bathroom has fallen in. Remedial works are now required and a full check of the subject property including the sub floor areas is recommended by timber/damp specialist contractor prior to purchase and estimates obtained for all necessary remedial works including exposure works.

Chimney stacks	
Repair category	2
Notes	Weathering noted to the chimney stacks. Remedial works required.

Roofing including roof space	
Repair category	2
Notes	The flat roof decks have a limited life span. Slate roof decks require regular attention. The roof decks were unseen due the position of the dwelling. A precautionary check by a roofing contractor is recommended prior to purchase and thereafter estimates obtained for any necessary remedial works.

Rainwater fittings	
Repair category	2
Notes	Corrosion noted to the rainwater goods. Remedial works required including repairs to adjacent areas if necessary. All rainwater goods should be monitored under wet weather conditions.

Main walls	
Repair category	2
Notes	Weathered, defective and spalling masonry/pointing noted. Remedial works required.

Windows, external doors and joinery	
Repair category	2
Notes	A number of the windows would benefit from upgrading and the failed double glazed units replaced. All windows and external doors should be checked prior to purchase in accordance with good practice.

External decorations	
Repair category	1
Notes	Ongoing maintenance to the external finishes should be anticipated in accordance with good practice.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	-
Notes	No access gained to the common stair and we presume this area is free of defects.

Garages and permanent outbuildings	
Repair category	-
Notes	None.

Outside areas and boundaries	
Repair category	2
Notes	Ongoing maintenance to the boundaries and garden areas should be anticipated in accordance with good practice.

Ceilings	
Repair category	2
Notes	Plaster defects noted.

Internal walls	
Repair category	2
Notes	Plaster defects noted.

Floors including sub-floors	
Repair category	2
Notes	Defective flooring noted.

Internal joinery and kitchen fittings		
Repair category	2	
Notes	The kitchen fittings require to be upgraded. Attention is required to internal doors, skirtings and facings. We recommend that safety glass be installed to internal areas.	

Chimney breasts and fireplaces		
Repair category	1	
Notes	Prior to use any fireplace, flue or chimney should be checked and made good by a suitable contractor.	

Internal decorations		
Repair category	2	
Notes	The internal decoration requires a full upgrade.	

Cellars		
Repair category	-	
Notes	None.	

Electricity	
Repair category	2
Notes	The electrical wiring system is dated with scorch marks noted to sockets within the living room. Remedial works are now required and advice should be sought from a Registered Electrician prior to purchase and estimates obtained. No tests were carried out by this firm.

Gas	
Repair category	1
Notes	We presume the gas supply is free of defects, however, the system has not been tested.

Water, plumbing and bathroom fittings		
Repair category	2	
Notes	The sanitary fittings are dated and would benefit from upgrading. We would recommend that all sections of lead plumbing be replaced using conventional materials. The sealants around the sanitary fittings would benefit from upgrading and adjacent areas checked and made good as necessary prior to purchase as these areas prone to leakage.	

Heating and hot water		
Repair category	1	
Notes	We presume the gas fired central heating system and hot water system have been checked by a suitable contractor and are free of defects. A precautionary check is recommended prior to purchase. No tests were carried out by this firm. We presume the electric fire is functional.	

Drainage	
Repair category	1
Notes	A precautionary check of the drainage system is always recommended prior to purchase. For the purposes of this report, we presume the system is free of

\sim		\circ	
\leq in(םור	Surv	$I \cap V$
	41C	Our	$\prime \cup \gamma$

defects.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We presume that all documentation is available for the installation of replacement windows. We presume the layout is original.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £360,000 (Three Hundred and Sixty Thousand Pounds Sterling). This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £250,000 (Two Hundred and Fifty Thousand Pounds Sterling).

Market conditions are steady at the present time.

Signed	Security Print Code [558646 = 6999] Electronically signed
Report author	D Lewis
Company name	J & E Shepherd
Address	12 Atholl Crescent, Edinburgh, EH3 8HA
Date of report	2nd April 2025



Property Address	
Address Seller's Name Date of Inspection	9 TAY STREET, POLWARTH, EDINBURGH, EH11 1DZ Estate of Sylvia Ross 1st April 2025
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat X Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block X Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes only Approximate Year of 0	No. of units in block
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms Gross Floor Area (exc	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 1 Other (Specify in General remarks) Cluding garages and outbuildings) 82 m² (Internal) m² (External)
Residential Element (greater than 40%) X Yes No
Garage / Parking / 0	Outbuildings
Single garage Available on site? Permanent outbuilding	☐ Double garage ☐ Parking space ☐ X No garage / garage space / parking space ☐ Yes ☐ No gs:
None.	

Construction								
Walls	Brick	X Stone	Con	crete Tin	nber frame	Othe	er (specify in Gen	eral Remarks)
Roof	Tile	Slate	Aspl	halt Fel	t	X Othe	er (specify in Gen	eral Remarks)
Special Risks								
Has the property s	suffered struct	tural movem	ent?				X Yes	No
If Yes, is this recei	nt or progress	sive?					Yes	X No
Is there evidence, immediate vicinity	•	ason to antic	ipate subsid	lence, heave,	landslip	or flood in the	e Yes	X No
If Yes to any of the	e above, prov	ide details in	General Re	emarks.				
Service Connec	tions							
Based on visual in of the supply in Ge			ices appear	to be non-ma	ains, plea:	se comment	on the type a	nd location
Drainage	X Mains	Private	None		Water	X Mains	Private	None
Electricity	X Mains	Private	None		Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None					
Brief description o	f Central Hea	ting:						
Gas fired with ste	eel radiators.							
Site								
Apparent legal iss	ues to be veri	fied by the c	onveyancer	. Please prov	/ide a brie	of description	in General R	emarks.
Rights of way	Shared driv	-		r other amenities		_	ared service conn	
Ill-defined boundari	ies	Agricul	ltural land inclu	ded with propert	у	Oth	er (specify in Ge	neral Remarks)
Location								
Residential suburb	X Res	sidential within to	own / city	Mixed residen	tial / comme	rcial Mai	nly commercial	
Commuter village	Rer	note village		Isolated rural p	property	Oth	er (specify in Ge	neral Remarks)
Planning Issues	;							
Has the property but If Yes provide details			I / altered?	X Yes	No			
Roads								
X Made up road	Unmade road	d Partly	completed nev	w road	Pedestrian a	access only	Adopted	Unadopted

General Remarks
At the time of inspection the property was found to require upgrading and the following observations were made: 1. We presume that all documentation is available for the installation of replacement windows. We presume the layout is original. 2. Repairs are required to the external fabric, in particular the main walls, roof, chimneys and rainwater goods. 3. Unacceptable levels of dampness were noted to be affecting sections of the walls and ceilings in the subject property and the ceiling within the bathroom has fallen in. Remedial works are now required and a full check of the subject property including the sub floor areas is recommended by timber/damp specialist contractor prior to purchase and estimates obtained for all necessary remedial works including exposure works. 4. The electrical wiring system requires upgrading. 5. The windows require to be upgraded and the failed double glazed units replaced. 6. Structural movement was noted to the subject property. This appears to be of longstanding and non progressive nature. 7. Upgrading required to internal fabric. The roof appears to be pitched and slated with flat sections presumed clad with waterproof membrane. The property benefits from a box room.
Essential Repairs
None. Stimated cost of essential renairs f Retention recommended? Ves No. Amount f

Comment on Mortgagea	bility				
The property forms suitable mortgage provider.	le security for mortgage purposes subject to the specific lending criteria o	f any			
Valuations					
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?					
Buy To Let Cases					
What is the reasonable rangementh Short Assured Tenan	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£			
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No			
Declaration					
Signed Surveyor's name	Security Print Code [558646 = 6999] Electronically signed by:- D Lewis				
Professional qualifications	BSC MRICS				
Company name	J & E Shepherd				
Address	12 Atholl Crescent, Edinburgh, EH3 8HA				
Telephone 0131 225 1234					
Fax	Fax 0131 220 3178				
Report date	2nd April 2025				



Property Questionnaire



SHEPHERD property questionnaire

Property address	9 Tay Street
	Edinburgh
	EH11 1DZ
Seller(s)	The Estate of Sylvia Ross (decd)
Completion date of property questionnaire	28 March 2025

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership				
	How long have you owned the property? 48 Years				
2.	Council tax				
	Which Council Tax band is your property in? (Please tick one) ☐ A ☐ B ☐ C ☐ D ☐ E ☐ F ☐ G ☐ H				
3.	Parking				
	What are the arrangements for parking at your property? (Please tick all that apply)				
	• Garage				
	Allocated parking space				
	• Driveway				
	Shared parking				
	On street				
	Resident permit				
	Metered parking				
	Other (please specify):				
4.	Conservation area				
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? ☐ No ☐ Don't know				

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☑ No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which	☐ Yes ☑ No
	you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ Yes ☐ No
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	☐ Yes ⊠ No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ Yes ☐ No
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☐ No
	(iii) Please describe the changes made to the windows doors, or patio approximate dates when the work was completed):	doors (with
	Please give any guarantees which you received for this work to your so agent.	olicitor or estate

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Gas-fired If you have answered yes, please answer the three questions below:	☐ Yes ☐ No ☑ Partial
	(i) When was your central heating system or partial central heating	g system installed?
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: Don't know	☐ Yes ☐ No
	(iii) When was your maintenance agreement last renewed? (Please and year).Don't know	provide the month
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☐ Yes ☐ No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☑ No ☐ Yes ☐ No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ☑ No

10.	Services							
a. Pl	Please tick which services are connected to your property and give details of the supplier:							
	Services	Connected	Supplier					
	Gas or liquid petroleum gas	Yes	Don't know					
	Water mains or private water supply	Yes						
	Electricity	Yes						
	Mains drainage	Yes						
	Telephone	No						
	Cable TV or satellite	No						
	Broadband	No						
				-				
b.	Is there a septic tank system at your property?			Yes				
	If you have answered yes, plea	⊠ No						
	(i) Do you have appropriate consents for the discharge from your septic tank?			☐ Yes ☐ No ☐ Don't Know				
	(ii) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract:			☐ Yes ☐ No				

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	☐ Yes ☐ No ☐ Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: Contibutions to the repair and maintenance of stair at 11 Tay Street	∑ Yes☐ No☐ Not applicable
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	⊠ Yes □ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: There is a shared garden with 11 Tay Street	⊠ Yes □ No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privatelyowned.) If you have answered yes, please give details:	☐ Yes ☑ No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ Yes ☑ No

Is there a common buildings insurance policy?	☐ Yes	
	□ No	
	⊠ Don't Know	
If you have answered yes, is the cost of the insurance included in	☐ Yes	
your monthly/annual factor's charges?	□ No	
	☐ Don't Know	
Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.		
Don't know		
Specialist works		
As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	☐ Yes ☑ No	
If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.		
As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	☐ Yes ☑ No	
If you have answered yes, please give details:		
If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	☐ Yes ☐ No	
If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:		
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? Please give details of any other charges you have to pay on a regular I upkeep of common areas or repair works, for example to a residents' a maintenance or stair fund. Don't know Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details: If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work			\boxtimes		
(ii)	Roofing			\boxtimes		
(iii)	Central heating			\boxtimes		
(iv)	National House Building Council (NHBC)			\boxtimes		
(v)	Damp course			\boxtimes		
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)					
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: ☐ Yes ☑ No					
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:				☐ Yes ☐ No ☑ Don't know	

16.	Notices that affect your property			
	In the past three years have you ever received a notice:			
a.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes ☐ No		
b.	that affects your property in some other way?	☐ Yes ☐ No		
c.	that requires you to do any maintenance, repairs or improvements to your property?	⊠ Yes □ No		
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.			

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): <u>Neil Ross</u>

Date: <u>28 March 2025</u>

shepherd.co.uk





Home Report Valuation Report Mortgage & Re-Mortgage Valuation **Executory Valuation Inheritance Tax Valuation Tax Valuation** Separation Valuation **Private Sale Valuation**

New Build, Development & Plot Valuation

Extension & Alteration Valuation Insurance Reinstatement Valuation

> **Portfolio Valuation Rental Valuation Driveby Valuation Desktop Valuation**

Energy Performance Certificate (EPC) Level Two Survey & Valuation Report Level Two Condition Report Expert Witness Report Council Tax Appeal





Commercial Valuation Commercial Agency Acquisitions & Disposals Commercial Lease Advisory Rent Reviews Asset Management Project Consultancy Development Appraisals Rating Commercial Property Auctions Property Management Professional Services Licensed Trade / Leisure



PROPERTY & CONSTRUCTION CONSULTANTS



Quantity Surveying Building Surveying Project Management Dispute Resolution Support Services Principal Designer Clerk of Works **Commercial EPC Fire Engineering Health & Safety Management Employer's Agent Energy Department Housing Services Development Monitoring**

Mediation Services

Aberdeen △▲▲ 01224 202800

△▲ 01292 267987

Bearsden

Birmingham **△** 0121 270 2266

Coatbridge

Cumbernauld △▲ 01236 780000

Dalkeith △▲ 0131 663 2780 **Dumbarton**

△▲ 01389 731682

Dumfries

△▲△ 01387 264333

Dundee

△▲ 01382 200454 △ 01382 220699

Dunfermline △ 01383 731841

East Kilbride △▲ 01355 248535

Edinburgh △▲ 0131 2251234 △ 0131 557 9300

Elgin

△▲ 01343 553939

△▲ 01324 635 999

Fraserburgh △▲ 01346 517456

Galashiels △▲ 01896 750150

Glasgow △△△ 0141 331 2807

Glasgow South △▲ 0141 649 8020

Glasgow West End

Greenock △△01475 730717

Hamilton

△△01698 897548

Inverness △△△01463 712239

Kilmarnock △△01563 520318

Kirkcaldy △ <u>△</u> 01592 205442

Leeds △ 0113 322 5069

Livingston △ ▲ 01506 416777

London ▲△ 02033 761 236

Montrose △▲ 01674 676768

Motherwell △ △ 01698 252229

Musselburgh △ △ 0131 653 3456

△▲ 01631 707 800

Paisley △ ▲ 0141 889 8334

△▲ 01738 638188 △ 01738 631631

Peterhead △△ 01779 470766

St Andrews △▲ 01334 477773 △ 01334 476469

Saltcoats △▲ 01294 464228

Stirling △△ 01786 450438 △ 01786 474476