




Home Report

shepherd.co.uk

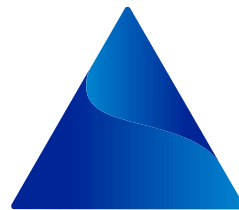

SHEPHERD

CHARTERED SURVEYORS

All Angles Covered

Residential | Commercial | Property & Construction



Contents

1. Scottish Single Survey
 2. Energy Performance Certificate
 3. Property Questionnaire
-



Scottish Single Survey



Single Survey

survey report on:

Property address	6 Joppa Terrace Edinburgh EH15 2HY
-------------------------	--

Customer	Lucia Main
-----------------	------------

Customer address	6 Joppa Terrace Edinburgh EH15 2HY
-------------------------	--

Prepared by	Shepherd Chartered Surveyors
--------------------	------------------------------

Date of inspection	26/05/2026
---------------------------	------------



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

Terms and Conditions

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose built upper villa flat.
Accommodation	Ground Floor: Entrance vestibule and access hall. First Floor: Hallway, living room, three bedrooms, dining room, kitchen and bathroom with wc.
Gross internal floor area (m²)	98m ² approx.
Neighbourhood and location	The subjects are situated within an established residential area of mixed style properties lying within the Joppa area of Edinburgh and convenient for local shopping, educational and social facilities.
Age	1890 approx.
Weather	Dry and sunny.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. Masonry type chimney stacks present.

Single Survey

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof appears to be of flat type presumed clad with waterproof membrane. The flat roof deck was unseen.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Cast iron rainwater goods. A parapet gutter is present to the front elevation.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are built of traditional solid stonework pointed externally. The rear outshot is of a rendered masonry type.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows throughout are of a UPVC double glazed type. The front and rear external access doors are of a timber variety.</p>
External decorations	<p>Visually inspected.</p> <p>UPVC finishes to windows.</p>
Conservatories / porches	<p>None.</p>

Single Survey

Communal areas	No communal areas noted to the time of inspection.
Garages and permanent outbuildings	Visually inspected. The property benefits from a single car garage located to the rear elevation. This is of a brick type with flat roof clad with waterproof membrane.
Outside areas and boundaries	Visually inspected. The property benefits from garden grounds. The boundaries are of a masonry walls and metal fencing.
Ceilings	Visually inspected from floor level. Plaster finishes noted together with suspended ceilings. Artex ceiling coatings are present within the kitchen.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plaster finishes noted.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. The floors throughout have fitted floor coverings.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The kitchen fittings are of a wall and base type. The internal doors, skirtings and facings are of a timber variety.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. A fireplace is present in the living room.
Internal decorations	Visually inspected. Papered and painted throughout.

Single Survey


Cellars	None.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply with the fuseboard located within the vestibule cupboard.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply with the gas meter located in the vestibule cupboard.</p>
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water us from the mains supply. The plumbing, where seen, is of copper supply pipes and PVC waste pipes. The sanitary fittings are located within the bathroom. A PVC cold water storage tank is located above the bathroom. Due to the age of the subject property it is possible lead plumbing is present.</p>
Heating and hot water	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property benefits from a gas fired central heating system with the gas boiler located in the dining room cupboard. This boiler provides hot water. An electric fire is present in the living room.</p>

Single Survey

Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Presumed to main public sewer.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

<p>Any additional limits to inspection</p>	<p>For flats / maisonettes</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>The property was fully floor covered at the time of inspection. The property was full of possessions/furnishings at the time of inspection. The cupboards were full of possessions at the time of inspection. No access was gained to any sub floor areas. No access was gained to the area below the sanitary fittings. No access was gained to the roof deck due to the position of the access hatch. The chimneys were seen from ground floor level only. The roof and rainwater goods were not monitored under wet weather conditions. At the time of inspection conditions were dry. The services were not tested. The heating system was not tested. Possessions were present within the garage. No access was gained to the area above the suspended ceiling within the subject property and we presume this area is free of defects.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.</p>
---	--

Sectional Diagram showing elements of a typical house

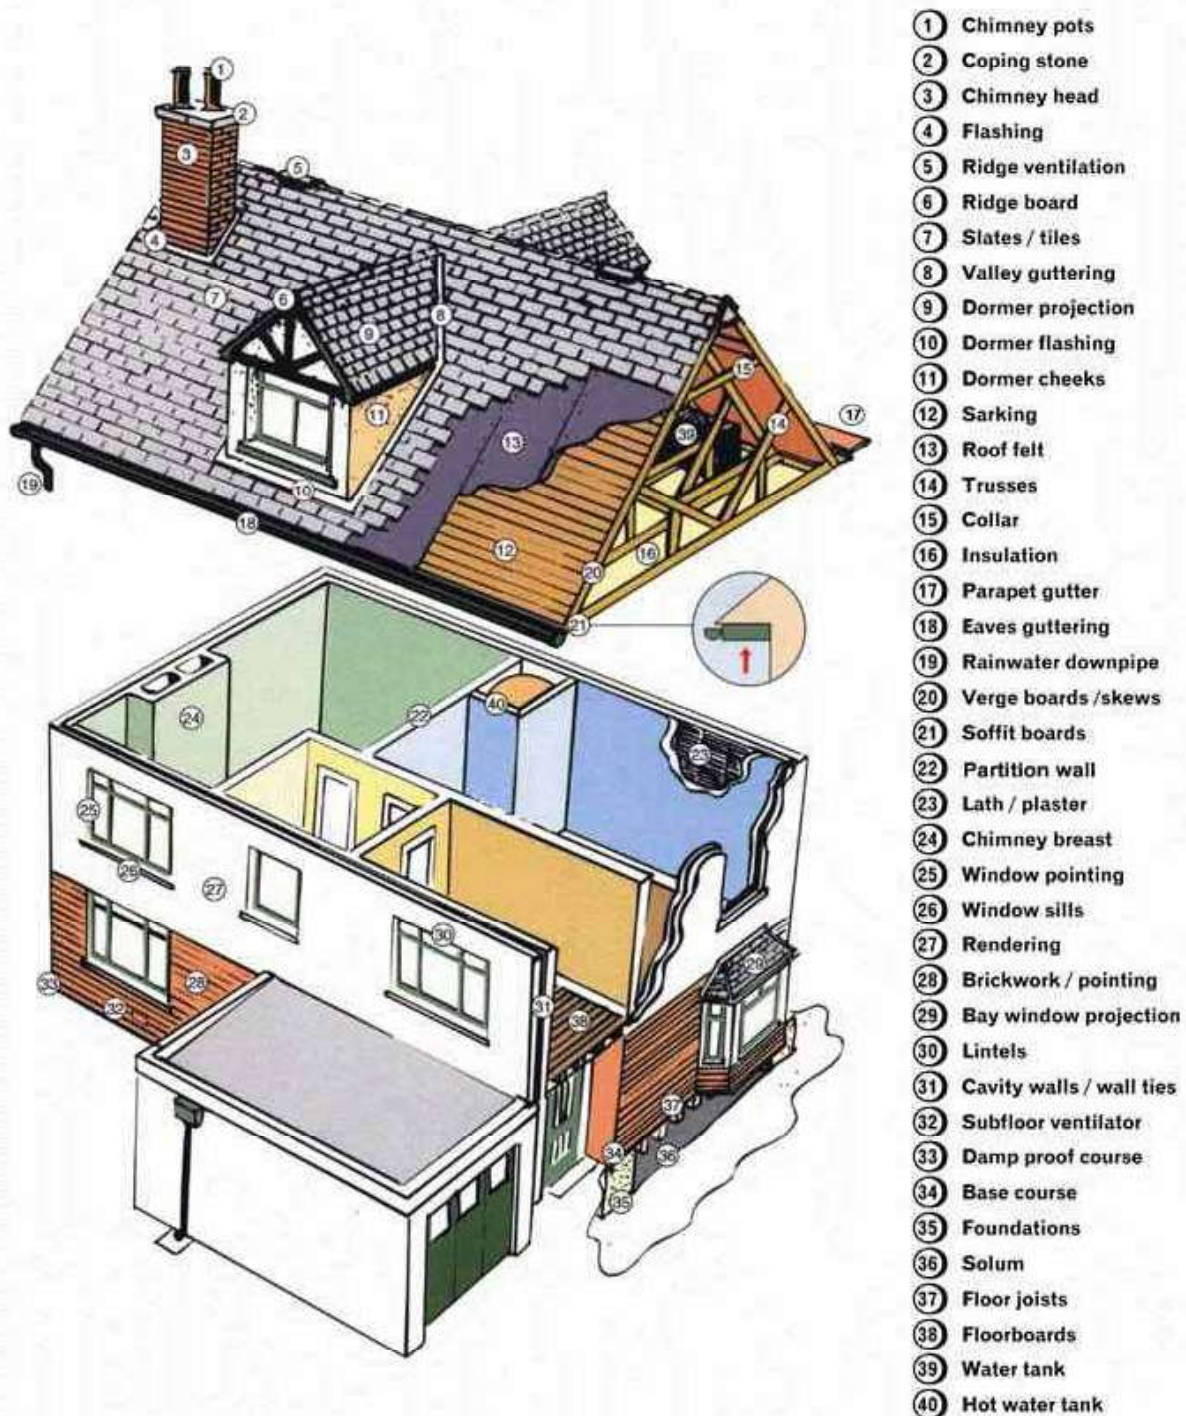


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


 Structural movement	
Repair category	1
Notes	Structural movement was noted to the subject property. This appears to be of longstanding and non progressive nature.


 Dampness, rot and infestation	
Repair category	2
Notes	Dampness noted to the wall linings at ground floor level together with leakage to the ceiling within the kitchen and wood boring insect infestation was noted around the access hatch to the roof deck. We would recommend that a timber/damp specialist contractor carry out a thorough inspection of the entire property prior to purchase and provide written estimates for all necessary remedial works including exposure works.


 Chimney stacks	
Repair category	2
Notes	Weathering noted to the chimney stacks. Remedial works required.


 Roofing including roof space	
Repair category	2
Notes	<p>The flat roof deck was unseen and leakage was noted to the kitchen ceiling. Remedial works required and advice should be sought from a suitable roofing contractor prior to purchase.</p> <p>We understand from the vendor that a current guarantee is available for the flat roof with six years remaining and this should be obtained prior to purchase.</p>


Single Survey

 Rainwater fittings	
Repair category	2
Notes	<p>Corrosion noted to the rainwater goods. Remedial works required including repairs to adjacent areas if necessary.</p> <p>A parapet gutter is present. Parapet gutters can be a source of timber decay and dampness and as such presume the gutter has been checked and maintained on a regular basis and adjacent areas is currently free of defects.</p> <p>A precautionary check of these areas is always recommended prior to purchase in accordance with good practice.</p> <p>We would recommend all rainwater goods be monitored under wet weather conditions.</p>

 Main walls	
Repair category	2
Notes	Weathering noted to the stonework, pointing and rendering. Remedial works required.

 Windows, external doors and joinery	
Repair category	2
Notes	The windows are of a dated type and as such we would recommend they be checked and upgraded by a suitable contractor in accordance with good practice.

 External decorations	
Repair category	1
Notes	Ongoing maintenance to the external finishes should be anticipated in accordance with good practice.

 Conservatories/porches	
Repair category	N/A
Notes	None.

Single Survey



Communal areas

Repair category	N/A
Notes	None.



Garages and permanent outbuildings

Repair category	2
Notes	Structural movement was noted to the garage in the form of cracking to the external walls. The vendor has informed us the flat roof to the garage was replaced in 2024. Dampness noted to the walls in the garage. Timber decay noted to the garage doors. Remedial works required to the garage.



Outside areas and boundaries

Repair category	2
Notes	Ongoing maintenance to the boundary walls and fencing will be required. An electrical substation is located within a 100 metres and as such any enquiries should be made with the relevant energy supplier.



Ceilings

Repair category	1
Notes	Minor plaster defects noted. Large sections of the dwelling have a suspended ceiling present. No access was gained and presume these areas are free of defects. We presume the artex ceiling coatings do not contain any hazardous type material.



Internal walls


Repair category	1
Notes	Minor plaster defects noted.





Floors including sub-floors


Repair category	1
Notes	Loose flooring noted. Our inspection of the flooring was restricted due to the presence of fitted floor coverings and we have presumed those areas not inspected and are free of defects.


Single Survey


 Internal joinery and kitchen fittings	
Repair category	1
Notes	The kitchen fittings are dated and recommend a suitable door be installed between the dining room and kitchen in accordance with fire regulations. We would recommend that safety glass be installed to internal areas.


 Chimney breasts and fireplaces	
Repair category	1
Notes	Prior to use any fireplace, flue or chimney should be checked and made good by a suitable contractor.


 Internal decorations	
Repair category	1
Notes	No serious defects noted.


 Cellars	
Repair category	N/A
Notes	None.

 Electricity	
Repair category	2
Notes	The electrical wiring system is of a mixed type and as such recommend they be checked and upgraded by a Registered Electrician. No tests were carried out by this firm.

 Gas	
Repair category	1
Notes	We presume the gas supply is free of defects, however, the system has not been tested.

 Water, plumbing and bathroom fittings	
Repair category	1
Notes	We presume the sealants around the sanitary fittings are functional and no defects are present to the adjacent areas. A precautionary check of the areas below/adjacent to the sanitary fittings is always recommended prior to purchase as these areas are prone to leakage. We presume that any lead plumbing has been replaced using conventional materials.

 Heating and hot water	
Repair category	1
Notes	We presume the gas fired central heating system and hot water system have been checked by a suitable contractor and are free of defects. A precautionary check is recommended prior to purchase. No tests were carried out by this firm.

 Drainage	
Repair category	1
Notes	A precautionary check of the drainage system is recommended prior to purchase. No tests were carried out by this firm.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Replacement windows have been installed. A garage has been erected, however, this appears historic.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £500,000 (Five Hundred Thousand Pounds Sterling).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £440,000 (Four Hundred and Forty Thousand Pounds Sterling).

Market conditions are steady at the present time.

Signed	<i>Darren Lewis</i> Electronically signed :- 27/05/2026 07:38
Report author	Darren Lewis
Company name	J & E Shepherd Chartered Surveyors
Address	12 Atholl Crescent Edinburgh EH3 8HA
Date of report	26/05/2026

Mortgage Valuation Report



Property Address

Address 6 Joppa Terrace, Edinburgh, EH15 2HY
Seller's Name Lucia Main
Date of Inspection 26/05/2026

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)
Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Other

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space

Available on site? Yes No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating and any non mains services:

Gas fired with steel radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Shared service connections
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

1. Replacement windows have been installed. A garage has been erected, however, this appears historic.
2. Maintenance and repair is required to the external fabric in particular, the main walls, chimneys and rainwater goods.
3. Dampness noted to the wall lining at ground floor level together with leakage to the ceiling within the kitchen and wood boring insect infestation was noted around the access hatch to the roof void. We would recommend that a timber/damp specialist contractor carry out a thorough inspection of the entire property prior to purchase and provide written estimates for all necessary remedial works including exposure works.
4. The flat roof deck was unseen and leakage was noted to the kitchen ceiling. Remedial works required and advice should be sought from a suitable roofing contractor prior to purchase.
5. Structural movement was noted to the subject property. This appears to be of longstanding and non progressive nature.
6. The garage would benefit from upgrading.
7. The electrical wiring system is of a mixed type and as such recommend they be checked and upgraded by a Registered Electrician.

Essential Repairs

None.

Estimated cost of essential repairs _____

Retention recommended? Yes No

Retention amount

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Mortgage Valuation Report

Declaration

Signed	<i>Darren Lewis</i> Electronically signed :- 27/05/2026 07:38
Surveyor's name	Darren Lewis
Professional qualifications	BSc, MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	12 Atholl Crescent, Edinburgh, EH3 8HA
Telephone	0131 225 1234
Email Address	edinburghadminresi@shepherd.co.uk
Date of Inspection	26/05/2026



**Energy
Performance
Certificate**



6 JOPPA TERRACE, JOPPA, EDINBURGH, EH15 2HY

Dwelling type: Ground-floor maisonette
Date of assessment: 26 May 2026
Date of certificate: 27 May 2026
Total floor area: 98 m²
Primary Energy Indicator: 331 kWh/m²/year


Reference number: 2564-1017-7205-6676-7204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,218	See your recommendations report for more information
Over 3 years you could save*	£2,796	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

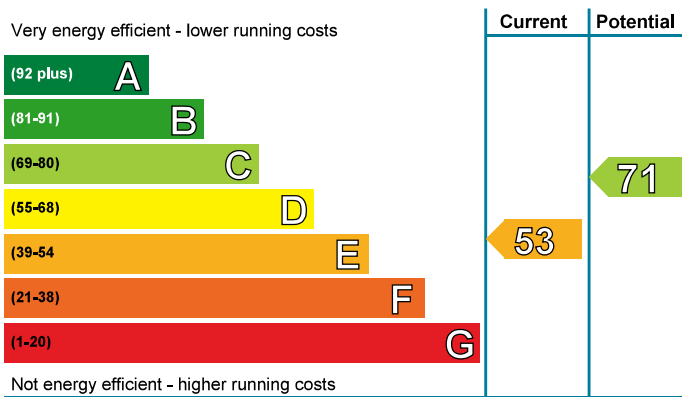


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (53)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

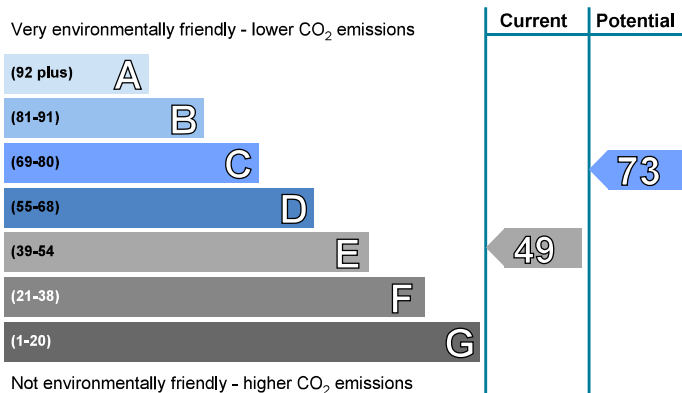

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (49)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£1980.00
2 Internal wall insulation	£7,500 - £11,000	£639.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£180.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Roof	Flat, no insulation	★☆☆☆☆	★☆☆☆☆
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system, no cylinder thermostat	★★★☆☆	★★★☆☆
Lighting	Below average lighting efficiency	★★★☆☆	★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 60 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.







Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,214 over 3 years	£2,400 over 3 years	
Hot water	£1,782 over 3 years	£1,800 over 3 years	
Lighting	£222 over 3 years	£222 over 3 years	
Totals	£7,218	£4,422	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£660		
2 Internal wall insulation	£7,500 - £11,000	£213		
3 Floor insulation (suspended floor)	£5,000 - £10,000	£60		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	18,048.88	N/A	N/A	N/A
Water heating (kWh per year)	5,182.88			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Darren Lewis
Assessor membership number:	EES/016141
Company name/trading name:	J & E Shepherd
Address:	12 Atholl Crescent Edinburgh EH3 8HA
Phone number:	0131 225 1234
Email address:	edinburgh@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerScotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



property questionnaire

Property address	6 Joppa Terrace Edinburgh EH15 2HY
Seller(s)	Lucia Main
Completion date of property questionnaire	23/05/2026

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 28 years
2.	Council tax
	Which Council Tax band is your property in? E
3.	Parking
	<p>What are the arrangements for parking at your property? (Please tick all that apply)</p> <ul style="list-style-type: none"> • Garage <input type="checkbox"/> Yes • Allocated parking space <input type="checkbox"/> No • Driveway <input type="checkbox"/> No • Shared parking <input type="checkbox"/> No • On street <input type="checkbox"/> Yes • Resident permit <input type="checkbox"/> No • Metered Parking <input type="checkbox"/> No • Other (please specify): <input style="width: 500px; height: 20px;" type="text"/>
4.	Conservation area
	<p>Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?</p> <p style="text-align: right;">No</p>

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	No
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes
	(ii) Did this work involve any changes to the window or door openings?	No
	<p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p> <p>New windows were installed around early 2000's (approx) - no changes to shape or structure of windows. There is no guarantee left on them.</p>	
7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p>	Yes

property questionnaire

	gas	
	<u>If you have answered yes</u>, please answer the three questions below:	
	i) When was your central heating system or partial central heating system installed?	
	5th May 2026	
	(ii) Do you have a maintenance contract for the central heating system?	No
	<u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to the property while you have owned it? <u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?	No
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u>, please give details:	No
10.	Services	
a.	Please tick which services are connected to your property and give details of the supplier:	
	Services	Connected
	Supplier	
	Gas or liquid petroleum gas	Yes
		Eon
	Water mains or private water supply	Yes
		Scottish Water
	Electricity	Yes
		Eon
	Mains drainage	Yes
		Local Authority

property questionnaire

	Telephone	No	
	Cable TV or satellite	Yes	no
	Broadband	Yes	virgin media
b.	Is there a septic tank system at your property?		No
	<u>If you have answered yes</u>, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		
	(ii) Do you have a maintenance contract for your septic tank?		
	<u>If have answered yes</u>, details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?		No
	<u>If you have answered yes</u>, please give details:		
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?		Yes
	<u>If you have answered yes</u>, please give details:		
	For roof and gutters this is usually a shared responsibility with the downstairs neighbour. roof was redone in 2017 the warranty is 15 years so 6 years left.		
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		Yes
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?		No
	<u>If you have answered yes</u>, please give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?		No
	<u>If you have answered yes</u>, please give details:		

property questionnaire

f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p>	No
12.	Charges associated with the property	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>	No
b.	<p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes</u>, is the cost of the insurance included in monthly/annual factor's charges?</p>	No
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13.	Specialist work	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	No
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	
14.	Guarantees	
a.	<p>Are there any guarantees or warranties for any of the following?</p>	

property questionnaire

	(i) Electrical work	Don't know
	(ii) Roofing	Yes
	(iii) Central heating	Yes
	(iv) National House Building Council (NHBC)	Don't know
	(v) Damp course	No
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	No
b.	<u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u>	
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes, please give details:</u>	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years? <u>If you have answered yes, please give details:</u>	No
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	<u>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u>	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): Lucia Main

Date: 23/05/2026



Acquisitions
 Building Surveying
 Commercial Agency
 Compulsory Purchase
 Contract Administration
 Development Appraisals and Consultancy
 Development/Bank Monitoring
 Dispute Resolution Services
 Drive By & Desktop Valuations
 Employers Agent
 Energy Services
 Energy Performance Certificates (EPCs)
 Executory Valuation
 Expert Witness Reports

Home Reports
 Housing Development Services
 Insurance Reinstatement
 Valuations (RCAs)
 Land & Property Auctions
 Lease Advisory
 Level Two Survey & Valuation Report
 Licensed Trade & Leisure
 Mediation Services
 Mortgage / Lending Valuations
 New Build & Plot Valuation
 Portfolio Valuations
 Principal Design Services
 (Health & Safety Management)
 Private Sale Valuation

Project Management
 Property & Asset Management
 Property Investment
 Public Sector
 Quantity Surveying
 Rating
 Rent Reviews
 Residential & Commercial Valuations
 Separation Valuation
 Space Planning
 Statutory Consents
 Tax Valuations

Aberdeen
01224 202800

Dumfries
01387 264333

Falkirk
01324 635999

Greenock
01475 730717

London
020 8893 3944

St Andrews
01334 477773
01334 476469

Ayr
01292 267987

Dundee
01382 200454
01382 220699

Fraserburgh
01346 517456

Hamilton
01698 891400

Montrose
01674 676768

Saltcoats
01294 464228

Birmingham
0121 270 2266

Dunfermline
01383 722337
01383 731841

Galashiels
01896 750150

Inverness
01463 712239

Musselburgh
0131 653 3456

Stirling
01786 450438
01786 474476

Coatbridge
01236 436561

East Kilbride
01355 229317

Glasgow
0141 331 2807

Kilmarnock
01563 520318

Oban
01631 707 800

Cumbernauld
01236 780000

Edinburgh
0131 225 1234
0131 557 9300

Glasgow Bearsden
0141 611 1500

Kirkcaldy
01592 205442

Paisley
0141 889 8334

Dalkeith
0131 663 2780

Glasgow South
0141 649 8020

Lanark
01555 663058

Perth
01738 638188

Dumbarton
01389 731682

Elgin
01343 614 949

Glasgow West End
0141 353 2080

Livingston
01506 416777

Peterhead
01779 470766

VALENTINE PROPERTY SERVICES LTD.

SPECIALISTS IN WOODWORM, DRY ROT AND DAMPNESS CONTROL
AND GENERAL BUILDING SERVICES



Registered Office:
37 TOWER STREET
EDINBURGH EH6 7BN

Telephone: 0131 - 553 7858
Fax: 0131 - 554 4674

Our Ref : SL/SW/2/13771

1st June 2026

Drummond Miller LLP
Glenorchy House
20 Union Street
Edinburgh
EH1 3LR

For the attention of Ms S Smith

Dear Madam

RE : 6 JOPPA TERRACE EDINBURGH

Thank you for your instructions to carry out a Damp survey of the above property, in connection with moisture readings recorded during a recent Home Report survey and following our inspection on Friday 29th May 2026 confirmation of our findings together with recommendations are as follows.

DAMP READINGS

Damp readings were recorded within the first floor of the property, on the soffit ceiling area on the joint between the Dining room and the rear facing kitchen. We believe that there is slight water ingress occurring from the roof fabric and we would recommend that a Roofing Contractor be instructed to inspect the exterior with a view to sourcing and repairing the water ingress. Once such works have been carried out, we believe the area of ceiling will simply dry out and require a decorative repair only.

We were also asked to inspect the ground floor, vestibule area, and on testing these areas moderate readings were recorded rather than excessively high, consistent with a ground floor vestibule area.

Some slight deterioration was noted to the plywood panelling within the vestibule, and this is simply due to being in contact with the external masonry. We would recommend maintaining the joints around the external door stops and possibly considering incorporating heating at the base of the stairs.

FUNGAL GROWTH – GARAGE

Evidence of fungal growth was noted to be affecting sections of the exposed masonry at the base of the wall, and we believe that this has been caused due to a leak from the roof, which



VALENTINE
SERVICES LTD



Catomance

APPROVED CONTRACTORS

Registered in Scotland: Company No. SC234451
VAT Registration No. 446 5793 12

Directors: Derek Aitken
Stuart Laing

has since been repaired. Due to the fungal growth we would recommend wall sterilisation to the exposed masonry and in order to facilitate this it will be necessary for us to remove the timber partition and discard from site for safe disposal.

The sterilisation will consist of brushing down to remove the fungal growth on the specified wall, as shown on the enclosed drawing, and carry out full sterilisation using our approved masonry Biocide up to a height of 1.5m. The cost for carrying out these works will be shown on the attached quotation.

Our quotation for carrying out the recommended remedial work is attached and on receipt of your acceptance arrangements will be made to commence the work as soon as possible.

The areas detailed above are the extent of the damage at the time of our inspection. Should we find that on opening up that further works are required then an additional quotation will be sent for your approval.

Please note that regarding the survey of the building, this is a non-invasive survey and therefore areas which are inaccessible we cannot comment on and therefore are not liable for any issues regarding sections which were inaccessible during our visit. These include lack of access to sub-floor areas, beneath floor coverings i.e. carpets and vinyl, behind dry lining, behind any wall paneling or bath paneling, behind kitchen units and behind tiling. Our survey consists of testing using an electronic moisture meter device to all accessible surfaces and also a visual inspection.

A normal supply of electricity and water must be available at all times on site for Our Technician's use.

Please note that we realise that the bulk of our work is fairly disruptive, but we shall endeavour to keep the disruption and inconvenience to a minimum. However, in order to reduce any inconvenience, we would recommend the removal of all furniture, soft furnishing, carpets etc from the immediate working areas prior to the works commencing. We shall not be held responsible for any loss or damage to items of furniture or personal belongings remaining in the immediate working areas.

Please note that should these works be subject to an insurance claim, we stress that our contract is with you and not the Insurance Company. Whilst we will assist you in your claim, under no circumstances are we prepared to wait until the Insurance Company settles your claim. In all cases our account should be settled within fourteen days as stipulated in our Terms and Conditions.

We enclose our invoice in relation to this inspection.

We trust that this is satisfactory however should you have any queries then please do not hesitate to contact us.

Yours faithfully



STUART LAING
For Valentine Property Services Limited

VALENTINE PROPERTY SERVICES LTD.


SPECIALISTS IN WOODWORM, DRY ROT AND DAMPNESS CONTROL
AND GENERAL BUILDING SERVICES



Registered Office:
37 TOWER STREET
EDINBURGH EH6 7BN

Telephone: 0131 - 553 7858
Fax: 0131 - 554 4674

6 Joppa Terrace

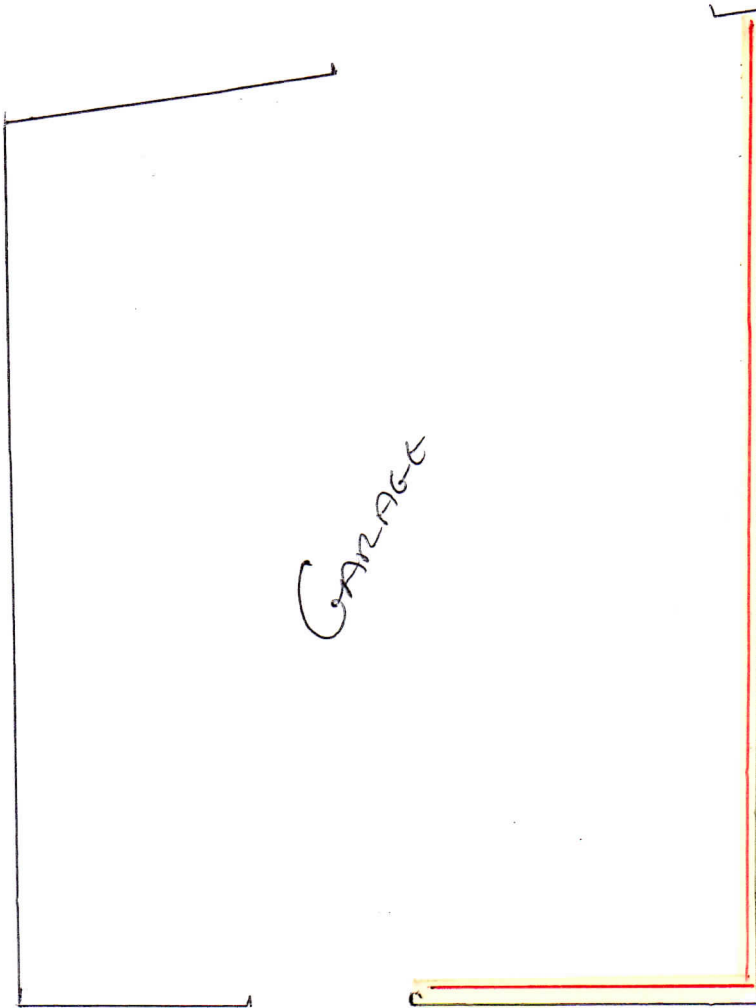

Masonry Sterilisation



APPROVED CONTRACTORS

Registered in Scotland: Company No. SC234451
VAT Registration No. 446 5793 12

Directors: Derek Aitken
Stuart Laing

VALENTINE PROPERTY SERVICES LTD.

SPECIALISTS IN WOODWORM, DRY ROT AND DAMPNESS CONTROL
AND GENERAL BUILDING SERVICES



37 TOWER STREET
EDINBURGH EH6 7BN

Telephone: 0131 - 553 7858
Fax: 0131 - 554 4674

Our Ref : SL/SW/2/13771

1st June 2026

Drummond Miller LLP
Glenorchy House
20 Union Street
Edinburgh
EH1 3LR

QUOTATION

For the attention of Ms S Smith

RE : 6 JOPPA TERRACE EDINBURGH

For carrying out sterilisation works to the fungal growth within the garage as detailed in our report dated 1st June 2026...

£874 (Plus VAT at standard rate)
Eight hundred and seventy four pounds

SL

STUART LAING
For Valentine Property Services Limited

Subject to the terms and conditions overleaf we will carry out remedial work and chemical treatment as above and as detailed in our attached Report and Schedule under the heading "Our Operatives".

To accept this Quotation please sign and return the attached Acceptance of Estimate Form.



APPROVED CONTRACTORS

Registered in Scotland: Company No. SC234451
VAT Registration No. 446 5793 12

Directors: Derek Aitken
Stuart Laing

TERMS AND CONDITIONS

1. This quotation shall only be binding upon the Company if accepted in writing within a period of 28 days from the date of issue.
2. The quotation exclusive of Value Added Tax which will be charged where applicable, at the appropriate rate.
3. The quotation is based on the report number quoted and refers only to the work detailed in such area as recommended in that report.
4. The Company shall be entitled at its discretion to alter or vary the specified materials or method of carrying out the work in whole or in part without increase in price to the client in the event of any such alteration or variation resulting in a substantial reduction in the cost of the work the Company will at its discretion make such allowance, if any, to the client as the company shall consider fair and reasonable.
5. Whilst the Company shall make every endeavour to start and complete the work by the dates indicated, it shall not be held responsible for any delays.
6. Payment is due nett on completion of the work, or if the work is done in stages, payment for any stage is due on completion of that stage of the work.
7. During the course of the contract the Company reserves the right to demand interim payments for work done. Failure to pay within seven days will result in withdrawal of labour until payment is received.
8. Except where occasioned by the negligence of the Company or its servants, the Company accepts no liability for loss, damage or injury, whether arising during or as a result of the work to the premises to be treated or any adjoining premises, or to any persons, or to any animal or plant life therein, or for any nuisance caused to the Owners or Occupiers of any such premises, and the client shall release and indemnify the Company from and against all claims by any person arising from such loss, damage or injury to the client for and the client will indemnify the Company against claims by any person for:-
 - (i) Damage to interior decoration and paint. Whilst the Company shall use its best endeavours to avoid any such damage there is always the risk of discolouration of ceilings, and particularly polystyrene tiles fixed to ceilings etc., arising through the treatment of ceiling joists. Redecoration should not be attempted until the preservation has dried thoroughly.
 - (ii) Collapse of insecure brickwork, stonework, cementwork, plasterwork, woodwork, etc., during or as the result of the Company's work. If after commencement of work unforeseen difficulties arise due to the collapse of insecure work or to irregular bonding thereof or any other cause the additional unforeseen work found to be necessary will be charged extra.
 - (iii) Damage arising as a result of the client's having:
 - (a) failed to remove from the premises any liquids or foodstuffs liable to contamination during the course of treatment.
 - (b) replaced carpets or floor coverings before the solvent has evaporated.
 - (c) layed 'vinyl' floor coverings on floors that have been treated, the client is advised not to lay such coverings without first obtaining the floor covering manufacturer's recommendations.
9. When chemical treatment is being carried out in any building which involves the use of any organic solvent material the electrical supply to the area being treated shall be switched off by the client in the interest of safety during treatment and for 48 hours after the conclusion thereof. Naked flames should not be permitted for the same period. However the client is required to provide a main electricity supply, free of charge, for lighting and power purposes.
10. On completion of the work and on payment of our account the Company shall issue a guarantee against re-infestation by the insects or fungi or the recurrence of rising damp as detailed in the areas treated in the Company's usual form a copy of which will be supplied on request. This guarantee is issued subject to the property being kept in a wind and water-tight condition with all water supply and waste disposal fittings being maintained in good condition.
11. The balance of our invoice to be paid in full within 14 days from date of invoice. If payment in full is not made the outstanding balance will be charged interest at 3% above bank base rate.

VALENTINE PROPERTY SERVICES LTD.

SPECIALISTS IN WOODWORM, DRY ROT AND DAMPNES CONTROL
AND GENERAL BUILDING SERVICES



37 TOWER STREET
EDINBURGH EH6 7BN

Telephone: 0131 - 553 7858
Fax: 0131 - 554 4674

Our Ref : SL/SW/2/13771

1st June 2026

Drummond Miller LLP
Glenorchy House
20 Union Street
Edinburgh
EH1 3LR

ACCEPTANCE OF QUOTATION

For the attention of Ms S Smith

RE : 6 JOPPA TERRACE EDINBURGH

For carrying out sterilisation works to the fungal growth within the garage as detailed in our report dated 1st June 2026...

£874 (Plus VAT at standard rate)
Eight hundred and seventy four pounds

Dear Sirs

I/we accept your Quotation in accordance with the terms and conditions

I/we should like the work to commence on _____

Signed _____ Dated _____



APPROVED CONTRACTORS
Registered in Scotland: Company No. SC234451
VAT Registration No. 446 5793 12

Directors: Derek Aitken
Stuart Laing